

Report NO: 17I010006

NIM-S13B

INTEL 82580EB PCI-Express 1G SFP 8 Ports Module

Firewall NIM Card

P5 Test Report

Summary	<input checked="" type="checkbox"/> Pass <input type="checkbox"/> Fail <input type="checkbox"/> Pass with Deviation (Comment: _____)			
	Test Results Category			
	Critical	Major	Minor	Enhancement
Defect Found	0	0	0	0
Defect Unsolved	0	0	0	0

Issue date

2017-04-10

QE Manager

KJ Wang

Test Engineer

Max Chang

Specification Validation

Main Specification

Item	Specification	Result			Note
		Pass	Fail	N/A	
Product Name	NIM-S13B	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
Form Factor	1G LAN Module	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
Main Chipset	2x INTEL® 82580EB Ethernet Controller(Co-lay i350-AM4)	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
Host Interface	2 PAIR BYPASS	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	
LAN Port	SFP 1GbE Connector x 8	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
Indicator	8 x LED for Active/Link	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	

O.S. Support

Item	Specification	Result			Note
		Pass	Fail	N/A	
DOS(graphic and texture mode)		<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
Microsoft Windows	Windows 7 64 bit	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
Linux	Linux Kernel 2.6.X	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	

Platform Information

Item	Device Information	Note
Product of department	NSD	
System Model	FWS-7520	
PCB Model / Version	FWB-7520 A0.3	
BIOS / Version	FWS-7520 R1.2 (K752AM12) (07/13/2016)	
Driver folder	\\172.16.1.21\sap-beta\Products\NIM-S13B\20161026	
CPU Type	Intel® Xeon® D-1548 Processor (12M Cache, 2.00 GHz)	
Memory Type	ADATA DDR4 2133 32GB SEC 516 K4A8G045WB BCPB	
SATA HDD	Innodisk SSD 3MG2-P 64GB	
USB DVD-ROM	Pioneer 8X (DVR-XD11T)	
LCD Monitor	Philips 244E2SB/96 24"	
Daughter Board	PER-T362 A0.3	
NIM Card	NIM-S13B A1.0	
Operating System	<input type="checkbox"/> English Ubuntu16.04 Kernel 4.4.0-21-generic x86_64	
	<input type="checkbox"/> CentOS7 kernel: 3.10.0-229.11.1e17.x86_64	
	<input type="checkbox"/> Windows 7 Ultimate 64Bit	
Power Supply	ATX Power Supply : FSP250-50LC 250W	
	AT Power Supply: N/A	
	DC Adapter : N/A	
Battery Model	N/A	
Chipset Information		
LAN chipset	INTEL® 82580EB Ethernet Controller	

Summary Table of contents:

1. Basic Function Test.....	4
1.1. LED / LCM / Button Function Test	4
1.2. Bypass Function Test	5
1.3. Gigabit Ethernet Function Test	6
1.4. Transceiver Compatibility Test.....	6
2. O.S Compatibility Test	7
2.1. Linux OS Compatibility Test	7
2.2. Windows OS Compatibility Test.....	8
3. Stability Test.....	9
3.1. LAN Endurance Test	9
4. LAN Performance Test	10
4.1 DUT and Test Equipments	10
4.2 RFC-2544 performance test (2 port)	11
4.3 RFC-2544 performance test (4 port)	12

1. Basic Function Test

1.1. LED / LCM / Button Function Test

Procedure:

Step1. To check Ethernet LED status can follow below methods.

- A. Use LAN cable to connect 40Gbps Host PC, transmit some packets between Host PC and DUT.
- B. Use LAN cable to connect 10Gbps Host PC, transmit some packets between Host PC and DUT.
- C. Use LAN cable to connect 1000Mbps switch between Server PC and DUT, transmit some packets between Server PC and DUT.
- D. Use LAN cable to connect 100Mbps switch between Server PC and DUT, transmit some packets between Server PC and DUT.
- E. Use LAN cable to connect 10Mbps switch between Server PC and DUT, transmit some packets between Server PC and DUT.

	Speed LED
40G bps	Color blue
10G bps	Color blue
1000Mbps	Color orange
100Mbps	Color green
10Mbps	Color blank

	Link/Act LED
Transmit	Yellow LED Blink

Result:

No.	Test item	Result			Remark
		Pass	Fail	N/A	
1	40G connection LAN LED action as below: Speed LED: Blue Link LED: Yellow / Blinking	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	
2	10G connection LAN LED action as below: Speed LED: Blue Link LED: Yellow / Blinking	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	
3	1G connection LAN LED action as below: Speed LED: Orange Link LED: Yellow / Blinking	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4	100M connection LAN LED action as below: Speed LED: Blue Link LED: Green / Blinking	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	
5	10M connection LAN LED action as below: Speed LED: Blue Link LED: Blank / Blinking	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	

1.2. Bypass Function Test

[X] No Support

Procedure:

- Step1. Under Linux, execute AAeon SDK(LanByPass) to test Bypass function under power on and power off mode.
- Step2. SDK set "power on" is "PassTru" and "power off" is "ByPass", and remove the AC power code. (G3 status)
- Step3. BIOS set power on is "PassTru" and power off is "ByPass", boot up system from G3 status..
- Step4. SDK set "power on" is "PassTru" and "WDT-ByPass", execute watch Dog.

Test result:

No.	Test item	Power on	Power off	Result			Remark
				Pass	Fail	N/A	
1	PassTru / ByPass should work properly by SDK control.	Bypass	Bypass	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	
		Bypass	PassTru	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	
		PassTru	Bypass	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	
		PassTru	PassTru	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	
2	LAN should switch to ByPass mode when system AC loss.(G3 status)	PassTru	ByPass	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	
3	Boot up from G3, LAN should switch to PassTru.	PassTru	ByPass	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	
4	WDT ByPass should work properly.			<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	

1.3. Gigabit Ethernet Function Test

Configuration:

1G switch: D-Link DGS-1210-16
 100M switch D-Link DES-1008A
 10M HUB SVEC FD916H
 100 meters CAT6 cable

Procedure:

Step1. Each LAN port connect DHCP server.
 Step2. Connect internet and ping Google (8.8.8.8).
 Step3. Each LAN port connect host PXE PC and DUT BIOS enable PXE function.
 Step4. BIOS select boot from LAN.
 Step5. Test each LAN port WOL function properly which from OS shutdown and Dos power off.
 Step6. Client PC to install and execute iperf and host PC execute iperf -s (Windows OS)
 Step7. Iperf test with 1G, 100M, 10M switch/Hub.
 <#yum install iperf>
 <#iperf -c 192.168.3.58 -w 100M -t 60 -i 1>

Test result:

Test item		Result			Note
		Pass	Fail	N/A	
Internet Browser (DHCP Server) Ping website(8.8.8.8) should work properly	All LAN	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
LAN Boot (PXE) Boot from LAN should work properly		<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	
Wake On LAN WOL should work properly when resume from S5/Dos off	All LAN	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1Gbps connection Iperf test result should not loss and max bandwidth must be in 900MB or more.	All LAN	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	Test max bandwidth: 900MB/s
100Mbps connection Iperf test result should not loss and max bandwidth must be in 90MB or more.	All LAN	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	Test max bandwidth: MB/s
10Mbps connection Iperf test result should not loss and max bandwidth must be in 9MB or more.	All LAN	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	Test max bandwidth: MB/s

1.4. Transceiver Compatibility Test

Procedure:

Connect transceiver and check if it works properly.

Test result:

Transceiver Test		Result			Note
		Pass	Fail	N/A	
1G	SX Volktek GBM-104 1.26Gbps	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1G	SX Axcen AXGE-5854-0511 SFP-1000SX	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	

2. O.S Compatibility Test

2.1. Linux OS Compatibility Test

Procedure:

Step1. Install Linux x86 or x64 OS from USB DVD ROM.

Step2. Enter command "lspci" to check if devices were detected.

Step3. Install LAN driver to system.

Step4. Execute the following command to test driver and verify

Step 4.1 Driver install

(1) Checked whether the command "Insmod drivername" can function normally, or not.

(2) Checked whether the command "rmmod drivername" can successful uninstall the driver, or not

Step 4.3 ifconfig Ethernet

(1) Execute command "ifconfig ethx down" close Ethernet.

(2) Execute command "ifconfig ethx up" start Ethernet.

Step 4.6 Jumbo Frame

Setting #ifconfig LAN mtu 9000

Check #ifconfig LAN (mtu will change from 1500 to 9000)

Step 5 Ping Google or Host PC.

#ping 8.8.8.8 or #ping 192.168.xx.xx -s 65500 -c 100.

Test result:

2.1.1 English Ubuntu16.04 Kernel 4.4.0-21-generic x86_64

Test Item	Result			Note	
	Pass	Fail	N/A		
System should not any error during installation process.	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>		
lspci to check LAN devices.	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>		
System should not error during LAN driver installation.	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>		
"Insmod drivername" should install driver normally.	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>		
"rmmod drivername" should uninstall driver normally.	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>		
Ifconfig	Ethernet interface should be closed when execute command ""ifconfig ethx down"	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
	Ethernet interface should be started when execute command ""ifconfig ethx up"	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
Jumbo	Jumbo function should work properly	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
Ping test	Ping should work normal.	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	

2.1.2 CentOS7 kernel: 3.10.0-229.11.1e17.x86_64

Test Item	Result			Note	
	Pass	Fail	N/A		
System should not any error during install process.	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>		
lspci to check LAN devices.	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>		
System should not error during LAN driver installation.	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>		
"Insmod drivername" should install driver normally.	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>		
"rmmod drivername" should uninstall driver normally.	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>		
Ifconfig	Ethernet interface should be closed when execute command ""ifconfig ethx down"	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	CentOS support ifup/ifdown

	Ethernet interface should be started when execute command ""ifconfig ethx up"	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
Jumbo	Jumbo function should work properly	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
Ping test	Ping should work normal.	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	

2.2. Windows OS Compatibility Test

Procedure:

- Step1. Install Windows OS from USB DVD ROM.
- Step2. Install all required driver to system.
- Step3. Connect internet, check each LAN port function.
- Step4. Insert USB flash, check each USB port function.
- Step5. ACPI S5 and reset function test.
- Step6. ACPI S3 and S4 function test if support graphics driver.

Test result:

2.2.1 Windows 7 Ultimate 64bit English version

Test Item	Result			Note	
	Pass	Fail	N/A		
System should not any error during install process.	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>		
All required driver should be installed.	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>		
Connected internet and ping the website should work properly. (Google: 8.8.8.8)	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	NIM module: port 1~8	
USB ports should work properly.	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>		
Shutdown	System should be shutdown when click "shutdown" icon	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
Reboot	System should be reset when click "Reset" icon.	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
S3	System should be sleep when click "Sleep" icon and resume function should work properly.	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
S4	System should be sleep when click "Sleep" icon and resume function should work properly.	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	

3. Stability Test

3.1. LAN Endurance Test

Configuration:

CPU: Intel® Xeon® D-1548 Processor (12M Cache, 2.00 GHz)
 RAM: ADATA DDR4 2133 32GB SEC 516 K4A8G045WB BCPB
 Storage: Transcend TS16GSSD25S-S 16GB
 Graphics card: Onboard graphics
 OS: CentOS5.6 Kernel 2.6.18-238.el5PAE
 LAN: Intel I211AT
 NIM module: NIM-S13B A1.0 (82580)

Procedure:

- Step1. Use SmartBits to test LAN endurance.
- Step2. Test Group: <LAN1-LAN2 bi-directional> ; <LAN3-LAN4 bi-directional>
 <LAN5-LAN6 bi-directional> ; <LAN7-LAN8 bi-directional>
- Step3. To set Frame size=1518 / loading=100 / time=43200sec
 <For 40G and 10G, the Frame size and loading need refer to throughput value>
- Remark: Max ports: 1Gx8

Test Result:

Test item	Result			Note
	Pass	Fail	N/A	
NIM Module LAN1~8 Endurance Test <Test result should not frame loss.>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	

Throughput Detail Report

[Summary Report](#) [Stray Frames Report](#) [Port Errors Report](#) [Packet Rate Report](#)

Name	Time	FrameSize	ILoad	TxFrames	RxFrames	LostFrames	Lost (%)	Throughput	Tx fps	Tx L2 bps	Rx fps	Rx L3 bps	Rx L2 bps
Total	11/09/16 06:08:35	1518	100.00000	28088425680	28088425680	0	0.00000	100.00000	650195	7999999758	650195	7802340467	7999999758
A Group	11/09/16 06:08:35	1518	100.00000	28088425680	28088425680	0	0.00000	100.00000	650195	7999999758	650195	7802340467	7999999758
A 1-1->1-2	11/09/16 06:08:35	1518	100.00000	3511053210	3511053210	0	0.00000	N/A	81274	999999970	81274	975292558	999999970
A 1-2->1-1	11/09/16 06:08:35	1518	100.00000	3511053210	3511053210	0	0.00000	N/A	81274	999999970	81274	975292558	999999970
A 1-3->1-4	11/09/16 06:08:35	1518	100.00000	3511053210	3511053210	0	0.00000	N/A	81274	999999970	81274	975292558	999999970
A 1-4->1-3	11/09/16 06:08:35	1518	100.00000	3511053210	3511053210	0	0.00000	N/A	81274	999999970	81274	975292558	999999970
A 2-1->2-2	11/09/16 06:08:35	1518	100.00000	3511053210	3511053210	0	0.00000	N/A	81274	999999970	81274	975292558	999999970
A 2-2->2-1	11/09/16 06:08:35	1518	100.00000	3511053210	3511053210	0	0.00000	N/A	81274	999999970	81274	975292558	999999970
A 2-3->2-4	11/09/16 06:08:35	1518	100.00000	3511053210	3511053210	0	0.00000	N/A	81274	999999970	81274	975292558	999999970
A 2-4->2-3	11/09/16 06:08:35	1518	100.00000	3511053210	3511053210	0	0.00000	N/A	81274	999999970	81274	975292558	999999970

4. LAN Performance Test

4.1 DUT and Test Equipments

4.1.1. DUT Specification

Hardware:

- Model name: FWS-7520
- M/B: FWB-7520 A0.3
- CPU: Intel® Xeon® D-1548 Processor (12M Cache, 2.00 GHz)
- RAM: ADATA DDR4 2133 32GB SEC 516 K4A8G045WB BCPB
- HDD: Innodisk SSD 3MG2-P 64GB
- NIM module: NIM-S13B A1.0

Software:

- BIOS: FWS-7520 R1.2 (K752AM12) (07/13/2016)
- Operating System: CentOS5.6 Kernel 2.6.18-238.el5PAE
- NIM LAN driver: igb-5.3.3.5.tar

4.1.2. Test Equipments Specification

SPIRENT Smartbits


- Chassis: SPIRENT Smartbits 600B
- Chassis Version: 2.80.003 (Cur) 2.50.000
- Chassis Serial #: 06014047
- Library: 6.00-29
- API: 5.50.42.01
- File: 0550042
- Module: 2 * LAN-3324A SmartMetrics XD 4-Port 10/100/1000Base-T Gigabit Ethernet
- Test Software: SmartFlow5.50.42.1

4.2 RFC-2544 performance test (2 port)

4.2.1. Throughput test (2 port)

Test Description:

1. In DUT System, set routing function enabled.
`<# echo 1 > /proc/sys/net/ipv4/ip_forward>`
2. Test Configuration as below Figure.

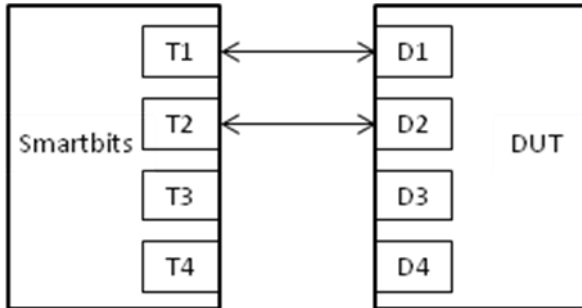

3. Smartflow\Test Group to add port1<->port2 with Bi-directional,
4. The tester set loading traffic from 1% to 100% and the traffic step is 50%.
5. Interaction Constants Duration Time Set to 60 Sec.
6. Test all LAN ports performance.

Test Result:

Test Group: <LAN1-LAN2 bi-directional>
 Test Group: <LAN3-LAN4 bi-directional >
 Test Group: <LAN5-LAN6 bi-directional>
 Test Group: <LAN7-LAN8 bi-directional >


Speed: 1000_Full	Frame Size(bytes)						
	64	128	256	512	1024	1280	1518
LAN ports							
1-2	64.42	100	100	100	100	100	100
3-4	63.64	100	100	100	100	100	100
5-6	64.42	100	100	100	100	100	100
7-8	63.64	100	100	100	100	100	100

4.3 RFC-2544 performance test (8 port)

4.3.1. Throughput test

Test Description:

1. In DUT System, set routing function enabled.
`<# echo 1 > /proc/sys/net/ipv4/ip_forward>`
2. Test Configuration as below Figure.

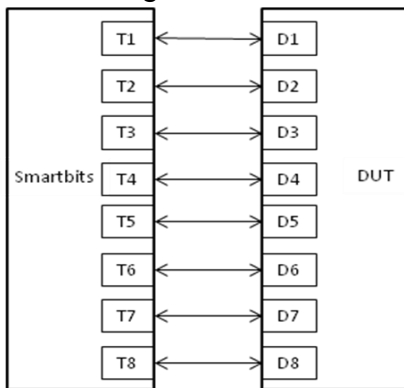

3. Smartflow\Test Group to add port1<->port2 with Bi-directional, port3<->port4 with Bi-directional, port5<->port6 with Bi-directional, port7<->port8 with Bi-directional.
4. The tester set loading traffic from 1% to 100% and the traffic step is 50%.
5. Interaction Constants Duration Time Set to 60 Sec.
6. Test all LAN ports performance.

Test Result:

Test Group: <LAN1-LAN2 bi-directional> ; <LAN3-LAN4 bi-directional>
 <LAN5-LAN6 bi-directional> ; <LAN7-LAN8 bi-directional>

Speed: 1000_Full	Frame Size(bytes)						
	64	128	256	512	1024	1280	1518
NIM 1~8	48.95	87.62	100	100	100	100	100