

Report NO: 14I010006

PER-C37L

INTEL i350-AM4 PCI-Express 1G Ethernet Module P5 Verification Test Report

Summary	<input checked="" type="checkbox"/> Pass <input type="checkbox"/> Fail <input type="checkbox"/> Pass with Deviation (Comment: _____)			
	Test Results Category			
	Critical	Major	Minor	Enhancement
Defect Found	0	0	0	0
Defect Unsolved	0	0	0	0

Issue date

2014/02/24

Approval

Tom Lin

Test Engineer

Max Chang

Version Released Records

Date	Version	Change History	Note
2010/04/21	P3-1001	1. Re-composing test Items	
2010/06/01	P2P3-1001	1. New Test Report	
2010/06/21	P2P3-1002	1. Add BIOS -> SPI ROM Setting (South Bridge - GPIO)	
2010/12/02	P2P2-1003	1. New Test Report	
2011/02/23	P2P3-1101	1. Re-composing test Items	
2011/03/04	P2P3-1102	1. Add Specification Validation	
2012/05/29	P2P3-1201	1. Add Summary Table of DTS	
2012/11/30	P2P3-1202	1. Rename P2/P3 Test Plan & Report Template 2. Add 7.3. Windows XP Professional English Version 32/64Bit	

Note :

For all test items in this report, 3 results have been defined and described as following:

- Pass:** Functionality work perfectly
Fail: Functionality failed and must be resolved in the next version
N/A: Functionality Not Applicable or Not Available

This test report would be updated when re-test completed in product next change version.

Specification Validation

Main Specification

Item	Specification	Result			Note
		Pass	Fail	N/A	
Product Name	PER-C37L	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
Form Factor	1G LAN Module	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
Main Chipset	1 x INTEL® i350-AM4 Ethernet Controller	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
Host Interface	PCI Express [x8]	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
LAN Port	8 x RJ-45 GbE Connector	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
	4 x RJ-45 GbE Connector	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
Indicator	8 x LED for Active/Link	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
	4 x LED for Active/Link	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
Qualification	CE/FCC Class A	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
Operation Temp.	0°C ~40°C	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
Dimension	137.8(L) x 88(W) mm	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	

O.S. Support

Item	Specification	Result			Note
		Pass	Fail	N/A	
Microsoft Windows	Windows Server 2008 64 bit	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
	Windows 7 32/64 bit	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
Linux	Linux Kernel 2.6.X	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
DOS	DOS (graphic and texture mode)	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	

Platform Information







Item	Device Information	Test Item
NIM module	PER-C37L A0.1	1,2,3
System Model/Version	FWS-7810 R1.0	1,2,3
CPU Board	FWB-7810 A1.0	1,2,3
Carrier Board	N/A	N/A
BIOS / Version	FWS-7810 R1.3(FW78AM13)(10/14/2013)	1,2,3
CPU Type	Intel® Xeon® CPU E3-1268L V3 @ 2.30GHz	1,2,3
Memory Type	Transcend DDR3L 1600 8GB SEC K4B4B0846B-HYK0	1,2,3
SATA HDD	TOSHIBA MK3276GSX 2.5" 320GB	1,2,3
SATA DVD-ROM	N/A	N/A
USB DVD-ROM	Pioneer 8X (DVR-XD11T)	1,2,3
LCD Monitor	View Sonic VT-2430-NT monitor	1,2,3
LVDS	N/A	N/A
CF-IDE interface	N/A	N/A
CF-SATA interface	N/A	N/A
Daughter Board	N/A	N/A
Expansion Board	N/A	N/A
Operating System	<input checked="" type="checkbox"/> English Cent OS5.6 2.6.18-238.el5xen	3-1
	<input checked="" type="checkbox"/> Windows Server 2008 R2 64bit	3-2
	<input checked="" type="checkbox"/> Windows 7 Ultimate 32bit/64bit	3-3
	<input type="checkbox"/> Windows XP Professional English SP3 32bit/64bit	N/A
Power Supply	ATX Power Supply : FSP250-50LC	1,2,3
	AT Power Supply: N/A	N/A
	DC Adapter :N/A	N/A
Battery Model	N/A	N/A
Chipset Information with Windows 7 Ultimate English Version 32Bit Driver Version		
Chipset Software	Intel(R) Chipset Device Software 9.4.0.1016(1/11/2013)	
South Bridge	Intel® C226	
Super IO Chipset	IT8728F	
VGA Chipset	Intel® HD Graphics P4600/P4700 9.18.10.3107(04/11/2013)	
Audio Chipset	N/A	
Ethernet Chipset	Intel(R) Gigabit CT Desktop Adapter 12.4.38.0(11/29/2012)	
I350 Ethernet	Intel(R) I350 Gigabit Network Connection 12.4.36.0(11/15/2012)	

Summary Table of contents:

Platform Information	4
1. LAN Function Test.....	6
1.1 Basic Function test.....	6
1.2 Throughput Test.....	7
2. O.S. Compatibility Test	12
2.1. English CentOS 5.6– Kernel 2.6.18.-238.e15xen	12
2.2. Windows Server 2008 R2 Enterprise-English Version 64Bit	12
2.3. Windows 7 Ultimate English Version 32/64Bit	13
3. Stress Test.....	13
3.1 LAN Test	13

1. LAN Function Test

1.1 Basic Function test

Connect two computers via different speed LAN HUB by using "Ping" instruction (1000 times)										
1000MBps LAN HUB		ZxXEL GS-105S								
100MBps LAN HUB		Accton CheetahSwitch Desktop-3005								
10MBps LAN HUB		SVEC FD916H								
OnBoard LAN1	Intel(R) i350-AM4 Gigabit LAN Controller						MAC Address	00-A0-C9-00-00-3B		
OnBoard LAN2	Intel(R) i350-AM4 Gigabit LAN Controller						MAC Address	00-A0-C9-00-00-3C		
OnBoard LAN3	Intel(R) i350-AM4 Gigabit LAN Controller						MAC Address	00-A0-C9-00-00-3F		
OnBoard LAN4	Intel(R) i350-AM4 Gigabit LAN Controller						MAC Address	00-A0-C9-00-00-40		
OnBoard LAN5	Intel(R) i350-AM4 Gigabit LAN Controller						MAC Address	00-A0-C9-00-00-3D		
OnBoard LAN6	Intel(R) i350-AM4 Gigabit LAN Controller						MAC Address	00-A0-C9-00-00-3E		
OnBoard LAN7	Intel(R) i350-AM4 Gigabit LAN Controller						MAC Address	00-A0-C9-00-00-41		
OnBoard LAN8	Intel(R) i350-AM4 Gigabit LAN Controller						MAC Address	00-A0-C9-00-00-42		
LAN Speed	Link / Speed LED	Active LED	LAN 1,2,3,4			LAN 5,6,7,8			Note	
			Pass	Fail	N/A	Pass	Fail	N/A		
1000MBps			<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>		
100MBps			<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>		
10MBps			<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>		
Wake On LAN			<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	S3/S4/S5/DOS off	
LAN Boot (PXE)			<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>		
Internet Browser (DHCP Server)			<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>		
LAN5-LAN6(BIOS) bypass1 function	Power on		<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>		
	Power off		<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>		
LAN7-LAN8(BIOS) bypass2 function	Power on		<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>		
	Power off		<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>		

1.2 Throughput Test

DUT Platform Information:

<input type="checkbox"/>	Fedora Core 13
<input checked="" type="checkbox"/>	Cent OS5.6 2.6.18-238.el5xen
<input type="checkbox"/>	Ubuntu 10.10 2.6.35-22-generic
<input type="checkbox"/>	Red Hat

Note : Connection-Level Performance (Interaction Constants Duration Time Set to 60 Sec.)


Graphics Media	Cent OS5.6 Default setting
LAN1	Intel(R) i350-AM4 Gigabit LAN Controller : Cent OS5.6 Default setting
LAN2	Intel(R) i350-AM4 Gigabit LAN Controller : Cent OS5.6 Default setting
LAN3	Intel(R) i350-AM4 Gigabit LAN Controller : Cent OS5.6 Default setting
LAN4	Intel(R) i350-AM4 Gigabit LAN Controller : Cent OS5.6 Default setting
LAN5	Intel(R) i350-AM4 Gigabit LAN Controller : Cent OS5.6 Default setting
LAN6	Intel(R) i350-AM4 Gigabit LAN Controller : Cent OS5.6 Default setting
LAN7	Intel(R) i350-AM4 Gigabit LAN Controller : Cent OS5.6 Default setting
LAN8	Intel(R) i350-AM4 Gigabit LAN Controller : Cent OS5.6 Default setting
Audio Driver	N/A

SMB Platform Information:

Chassis	SPIRENT Smartbits 600B
Chassis Version	2.80.003 (Cur) 2.50.000
Chassis Serial #	06014047
Library	6.00-29
API	5.50.42.01
File	0550042
Module	2 * LAN-3324A SmartMetrics XD 4-Port 10/100/1000Base-T Gigabit Ethernet
Test Software	SmartFlow5.50.42.1


Test Result:

1. Binary Direction(LAN1 Intel(R) i350-AM4 Gigabit LAN ⇔ LAN2 Intel(R) i350-AM4 Gigabit LAN)

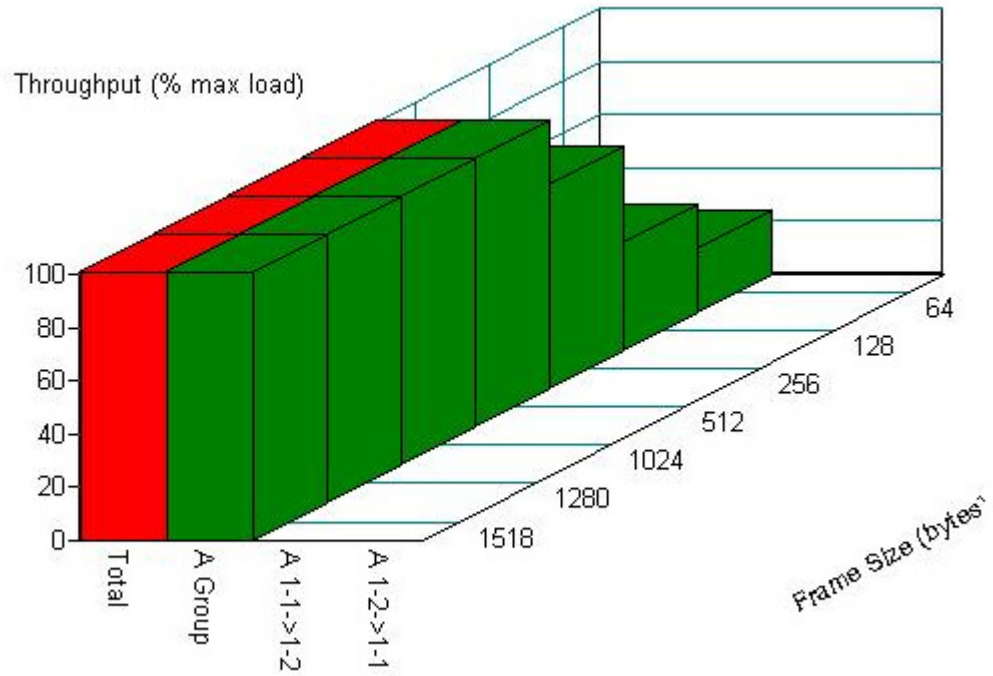


<u>Name/Framesize</u>	<u>64</u>	<u>128</u>	<u>256</u>	<u>512</u>	<u>1024</u>	<u>1280</u>	<u>1518</u>
Total	23.42969	40.44531	76.02344	100	100	100	100
A Group	23.42969	40.44531	76.02344	100	100	100	100
A 1-1->1-2	N/A	N/A	N/A	N/A	N/A	N/A	N/A
A 1-2->1-1	N/A	N/A	N/A	N/A	N/A	N/A	N/A

2. Binary Direction(LAN3 Intel(R) i350-AM4 Gigabit LAN ⇔ LAN4 Intel(R) i350-AM4 Gigabit LAN)

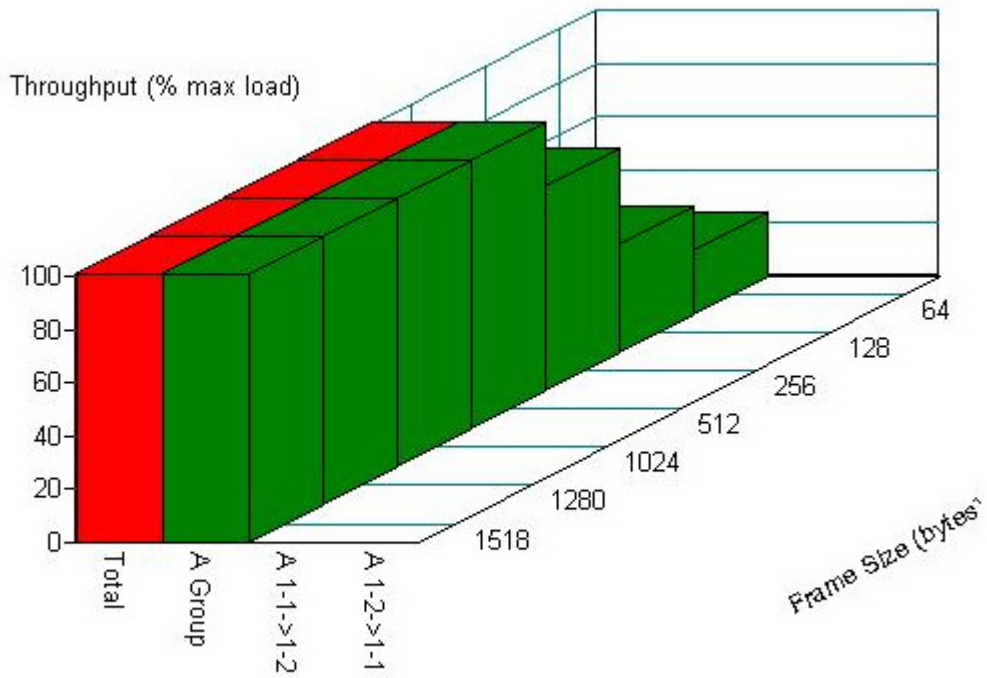


<u>Name/Framesize</u>	<u>64</u>	<u>128</u>	<u>256</u>	<u>512</u>	<u>1024</u>	<u>1280</u>	<u>1518</u>
Total	23.42969	40.44531	76.02344	100	100	100	100
A Group	23.42969	40.44531	76.02344	100	100	100	100
A 1-1->1-2	N/A	N/A	N/A	N/A	N/A	N/A	N/A
A 1-2->1-1	N/A	N/A	N/A	N/A	N/A	N/A	N/A

3. Binary Direction(LAN5 Intel(R) i350-AM4 Gigabit LAN ⇔ LAN6 Intel(R) i350-AM4 Gigabit LAN)

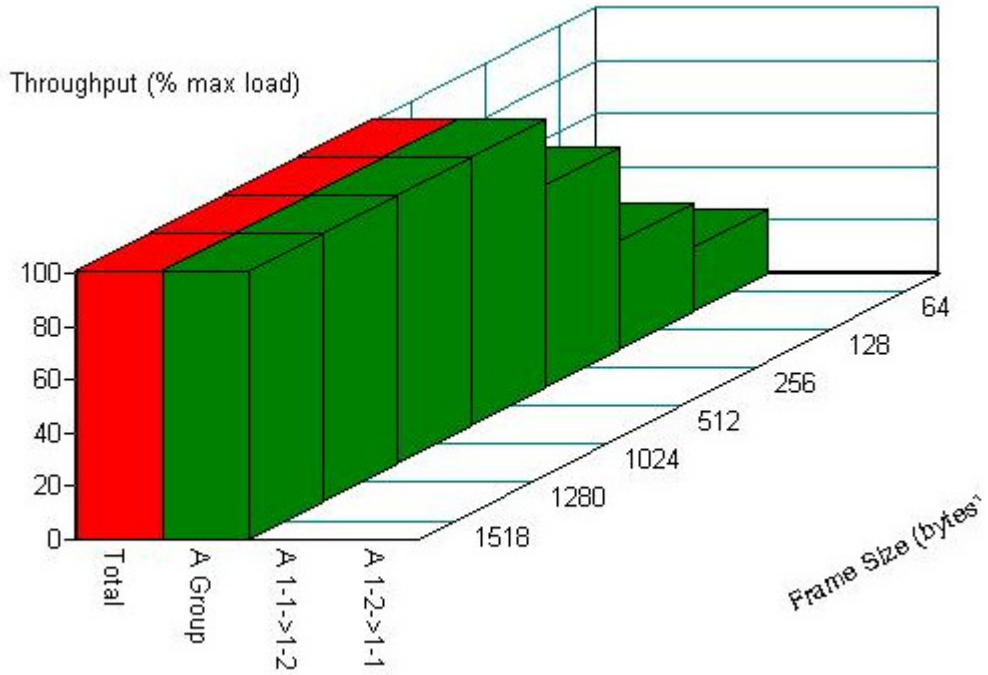

<u>Name/Framesize</u>	<u>64</u>	<u>128</u>	<u>256</u>	<u>512</u>	<u>1024</u>	<u>1280</u>	<u>1518</u>
Total	23.42969	40.44531	75.25	100	100	100	100
A Group	23.42969	40.44531	75.25	100	100	100	100
A 1-1->1-2	N/A	N/A	N/A	N/A	N/A	N/A	N/A
A 1-2->1-1	N/A	N/A	N/A	N/A	N/A	N/A	N/A

4. Binary Direction(LAN7 Intel(R) i350-AM4 Gigabit LAN ⇔ LAN8 Intel(R) i350-AM4 Gigabit LAN)

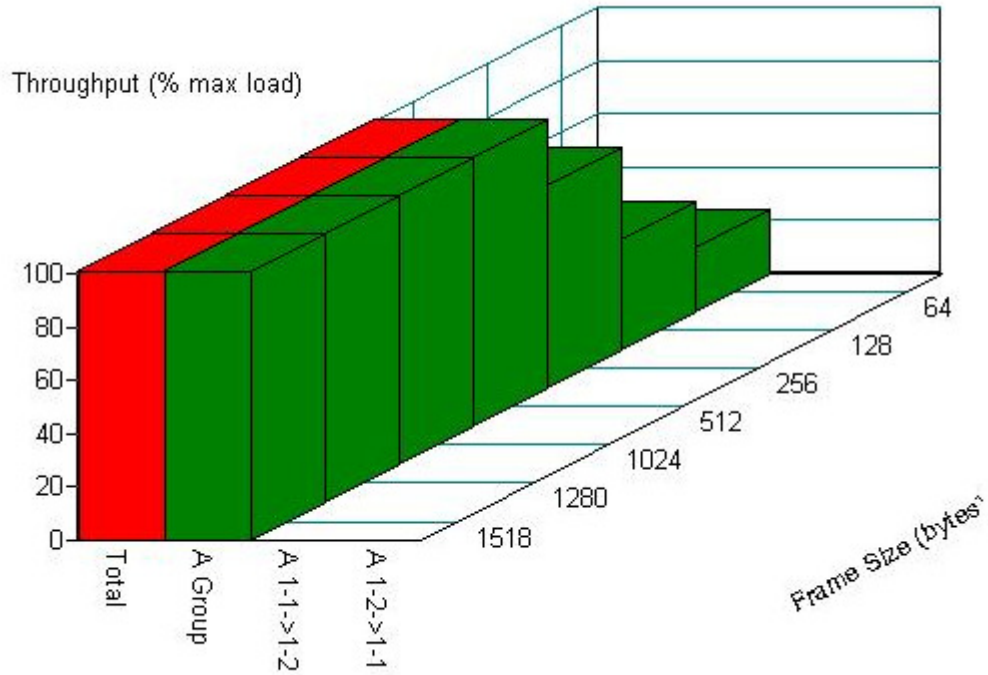

<u>Name/Framesize</u>	<u>64</u>	<u>128</u>	<u>256</u>	<u>512</u>	<u>1024</u>	<u>1280</u>	<u>1518</u>
Total	23.42969	41.21875	75.25	100	100	100	100
A Group	23.42969	41.21875	75.25	100	100	100	100
A 1-1->1-2	N/A	N/A	N/A	N/A	N/A	N/A	N/A
A 1-2->1-1	N/A	N/A	N/A	N/A	N/A	N/A	N/A

2. O.S. Compatibility Test

2.1. English CentOS 5.6– Kernel 2.6.18.-238.e15xen

[] No Support

Driver Information:

Chipset Software	CentOS 5.6 default driver
Graphics Media	CentOS 5.6 default driver
LAN Driver	Intel(R) i350-AM4 Gigabit LAN: CentOS 5.6 default driver

Install OS to SATA HDD:

Installation	Result			Note
	Pass	Fail	N/A	
English CentOS 5.6 - Kernel 2.6.18-238.e15PAE #1 SMP	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	Type uname -a

Test Result:

Test Item	Result			Note
	Pass	Fail	N/A	
Network Function Test				
Connect to Internet – LAN 1	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
Connect to Internet – LAN 2	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
Connect to Internet – LAN 3	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
Connect to Internet – LAN 4	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
Connect to Internet – LAN 5	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
Connect to Internet – LAN 6	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
Connect to Internet – LAN 7	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
Connect to Internet – LAN 8	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	

2.2. Windows Server 2008 R2 Enterprise-English Version 64Bit

[X] x64 Driver Information:

Chipset Software	Intel(R) Chipset Device Software 9.4.0.1016(1/11/2013)
Graphics Media	Intel® HD Graphics 4600 9.18.10.3107(04/11/2013)
LAN Driver	Intel(R) I350 Gigabit Network Connection 12.4.36.0(11/15/2012)

Install OS to SATA HDD:

Installation	Result			Note
	Pass	Fail	N/A	
English Windows Server 2008 R2 mode	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	

Test Results:

Test Item	Result			Note
	Pass	Fail	N/A	
LAN Function Test				
LAN1 --- Auto	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
LAN2 --- Auto	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
LAN3 --- Auto	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
LAN4 --- Auto	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
LAN5 --- Auto	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
LAN6 --- Auto	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
LAN7 --- Auto	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
LAN8 --- Auto	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	

2.3. Windows 7 Ultimate English Version 32/64Bit

[X] x32 Driver Information:

Chipset Software	Intel(R) Chipset Device Software 9.4.0.1016(1/11/2013)
Graphics Media	Intel® HD Graphics 4600 9.18.10.3107(04/11/2013)
LAN Driver	Intel(R) I350 Gigabit Network Connection 12.4.36.0(11/15/2012)

[X] x64 Driver Information:

Chipset Software	Intel(R) Chipset Device Software 9.4.0.1016(1/11/2013)
Graphics Media	Intel® HD Graphics 4600 9.18.10.3107(04/11/2013)
LAN Driver	Intel(R) I350 Gigabit Network Connection 12.4.36.0(11/15/2012)

Install OS to SATA HDD:

Installation	Result			Note
	Pass	Fail	N/A	
English Windows 7 Ultimate mode	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	32bit IDE mode 64bit AHCI mode

Test Results:

Test Item	Result			Note
	Pass	Fail	N/A	
LAN Function Test				
LAN1 --- Auto	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
LAN2 --- Auto	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
LAN3 --- Auto	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
LAN4 --- Auto	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
LAN5 --- Auto	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
LAN6 --- Auto	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
LAN7 --- Auto	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
LAN8 --- Auto	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	

3. Stress Test

	Hardware Information with Windows 7 Ultimate English Version 32Bit Driver Version
CPU	Intel® Xeon® CPU E3-1268L V3 @ 2.30GHz
Memory	Transcend DDR3L 1600 8GB SEC K4B4B0846B-HYK0
HDD	TOSHIBA MK3276GSX 2.5" 320GB

3.1 LAN Test

Test Item	Result			Note
	Pass	Fail	N/A	
Copy files from Server over 24 hours.	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	LAN1,LAN2, LAN3,LAN4, LAN5,LAN6, LAN7,LAN8