

1. Test item list -----	2
2. Random Vibration Operation Test -----	3
3. Random Vibration Non-Operation Test -----	4

Test Configuration:

Num	Item	Spec
1.	Control Box:	ARC-636M / 3U Rack Mount Firewall Chassis
	1. Main Board	AAEON FWB-880M A0.2 (BIOS: 1.0)
	2. CPU	Intel Pentium 4 / 3.2GHz
	3. Memory	512B ELPIDA E5108AB-5C-E (DDR2-533)
	4. HDD	Seagate ST340014A 40GB
	7. Power Supply	I-STAR TC-3U46 / 460W (ATX)

CPU Cooler



Test Date: 12-20~21-2005

Test Product: ARC-636M (FWB-880M A0.2)

Test Site: AAEON QA Internal Lab.

Performed By: Rex Chang


Test Standard: Reference IEC68-2-64 Testing procedures
Test Fh : Vibration boardband random test

Test Equipment:

Vibration Simulator System
KING DESIGN Co. LTD.
Model: KD 9363-EM-600F2K-40N20
Serial Number: UU110099090
Date of Calibration: 10/20/2005

Test Condition:

1. Operation
2. Test Acceleration: 0.5 G Random
3. Test Frequency: 5-500Hz
4. Test Axis: X, Y, Z axis
5. Test Time: 60min each axis
6. Test Software: Windows 2000 / Run one Microsoft media player simultaneously.
7. Test Vibration Curve:

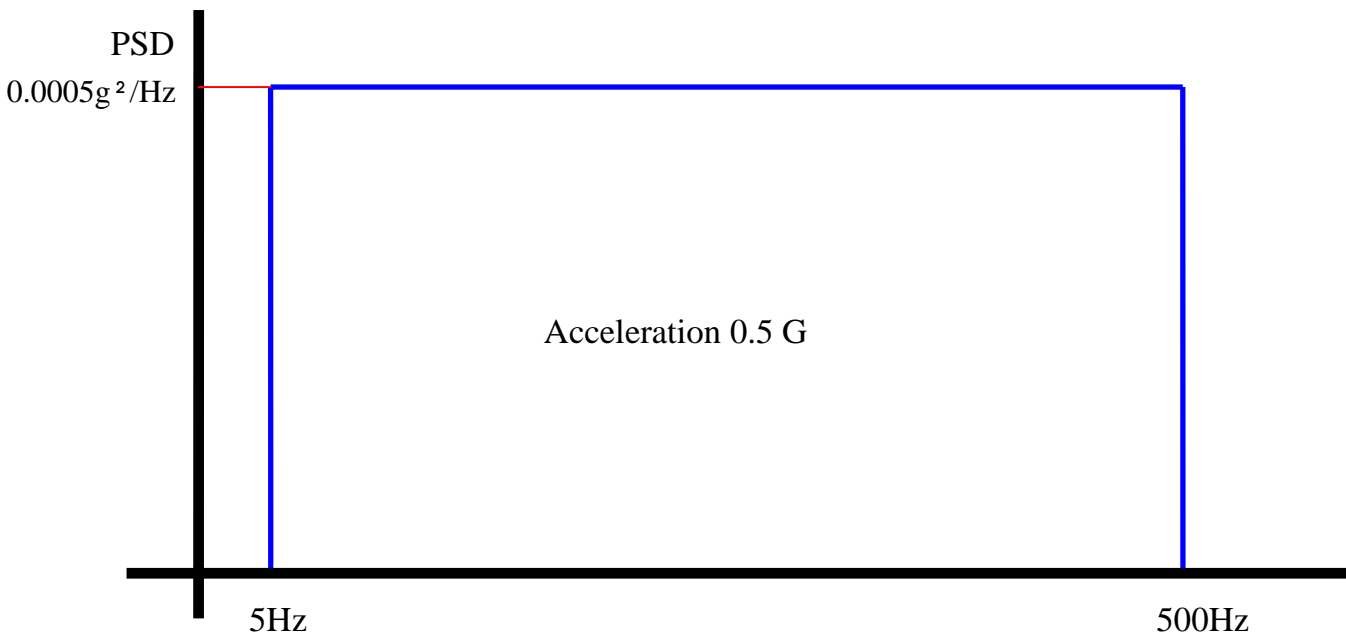

Test Result:

No problem was found during the random vibration operation test.

Test Date: 12-21-2004

Test Product: ARC-636M (FWB-880M A0.2)

Test Site: AAEON QA Internal Lab. -

Performed By: Rex Chang


Test Standard: Reference IEC68-2-64 Testing procedures
Test Fh : Vibration boardband random test

Test Equipment:

Vibration Simulator System
KING DESIGN Co. LTD.
Model: KD 9363-EM-600F2K-40N20
Serial Number: UU110099090
Date of Calibration: 10/20/2005

Test Condition:

1. Non - Operation
2. Test Acceleration: 1.5G Random
3. Test Frequency: 5-500Hz
4. Test Axis: X, Y, Z axis
5. Test Time: 60min each axis
6. Test Software: Windows 2000 / Run one Microsoft media player simultaneously.
7. Test Vibration Curve:

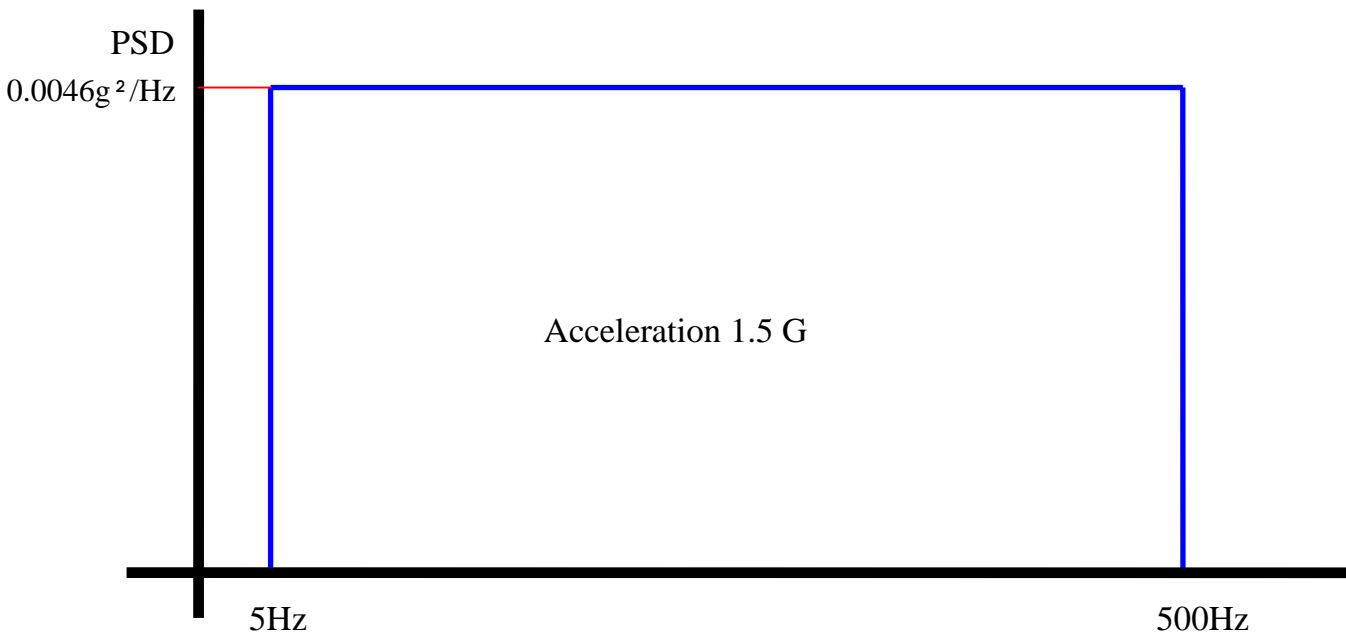

Test Result:

No problem was found after the random vibration non-operation test.