

# OMNI-2155-SKU

with 2.5" SATA HDD

Supplier: POKI / Carton size: 530(L)\*445(W)\*200(H) mm

## Package Drop Test Report

Report No: 16P030020



Summary	<p><input type="checkbox"/> <b>Pass</b></p> <p><input type="checkbox"/> <b>Fail</b> Note : There is/are ___ defect(s) not list in the report, please check it in the DTS Website.</p> <p><input checked="" type="checkbox"/> <b>Pass with Deviation</b> <b>Comment:</b> The EPE had crack, but structure of EPE and system is OK</p>
---------	--

Issue date

2016-07-27

QE Manager

KJ Wang

Test Engineer

Rex Chang

# Test item list

---

1. *Test item list* ----- 2
2. *Configuration of EUT* ----- 3
3. *Package drop test* ----- 4

## Testing Result

Num	Test item list	Result	Remark
1	Package drop test	Pass	

# Configuration of EUT

Num	Item	Spec
<b>OMNI-2155-SKU</b>		
1	15.6" TFT LCD	AUO.G156XW01V1.1366x768, LED backlight
2	CPU Board	PBA-SKU6 Ver. A0.2
3	CPU	Intel Skylake-U i5-6300U / 3.0GHz
4	BIOS	OMNI-2215SKU R0.4 (OMSKAM04)(06/16/2016)
5	Wide Temp. Memory	Transcend 8GB / DDR4 2133 / SEC K4A4G08 5WE BCPB
6	Wide Temp. 2.5" SATA HDD	TOSHIBA MQ01AAD010C / 100GB
7	Test Software	Windows 10 / Run one Microsoft media player simultaneously.
8	Adapter	FSP FSP120-ABAN2 / 19V; 6.32A

## Photos

### After Test



# Package Drop Test

**Test Date:** 05-16-2016

**Test Product:** OMNI-2155-BT

**Test Site:** AAEON QE Dept.

**Test Standard:**

Reference ISTA PROJECT 1A

**Test Equipment:**

Drop Tester


KING DESIGN Co. LTD

Model: KD-128A

Serial Number: UU110099185

**Test Condition:**

1. Test Phase: One corner. Three edges. Six face
2. Test Cycle: 1 Cycle
3. Test Height: 76cm
4. Test Weight: 6.78Kg
5. Sample Package: 1unit in single-package.
6. Test Drawing:

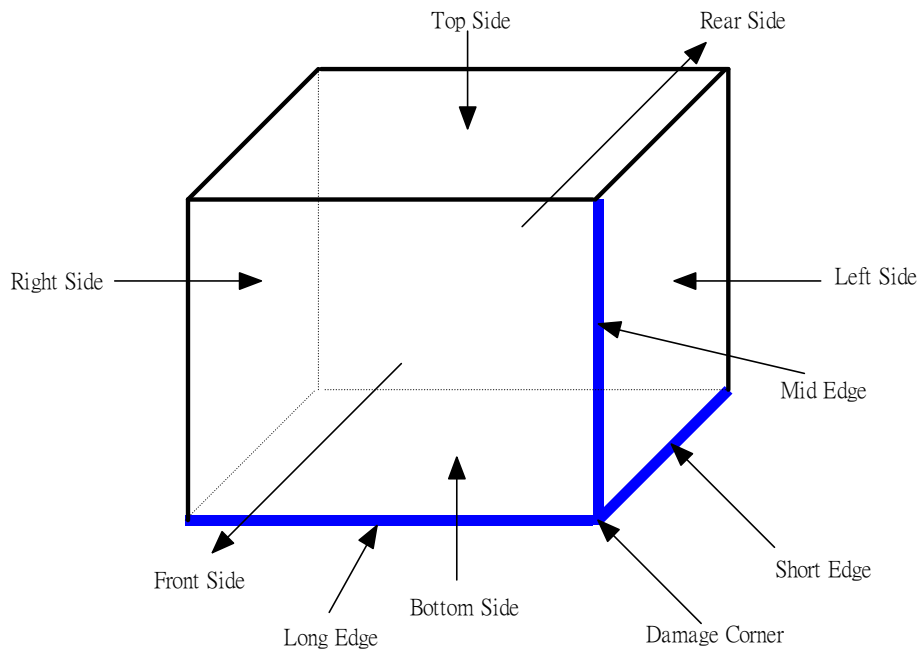

**Test Result:**

The EPE had crack, but the structure is OK, System no structure deformation and function was working normally after drop test.