

KING DESIGN INDUSTRIAL CO., LTD.

4F, NO. 3, Lane 270, Pei Shen Road Sec. 3,

Shen Keng Dist., New Taipei City, 222, Taiwan, R.O.C

TEL: 886-2-2662-5100 FAX: 886-2-2662-3094

VIBRATION TEST LABORATORY<http://www.kdi.tw><http://www.vibration.com.tw>

E-mail:service@kdi.tw

TESTING / INSPECTION REPORT

REPORT NO : ST-150701-1

COMPANY : AAEON Technology Inc.

ADDRESS : 5F, No.135, Lane 235, Pao Chiao Rd.

Hsin-Tien City, Taipei, Taiwan, R. O. C.

TEL : 886-2-8919-1234

FAX : 886-2-8919-1049

SPECIMEN : BOXER-6404 (With CFast)

DATE OF RECEIVED : 2015/06/30

DATE OF TESTED : 2015/06/30

TEST / INSPECTION ITEMS : Shock Test

REMARKS :

- The laboratory is accredited by ISO/IEC 17025 General Requirements for the Competence of Calibration and Testing Laboratory.
- The results only apply to the device under test.
- This report is 11 pages, and no part of it may be abstracted or reproduced.

Test Engineer :

Te ty

Approval Signatory

David Lee

Laboratory Head :

*Hsin Tai Cheng**2015.7.3*

KING DESIGN INDUSTRIAL CO., LTD.

4F, NO. 3, Lane 270, Pei Shen Road Sec. 3,

Shen Keng Dist., New Taipei City, 222, Taiwan, R.O.C

TEL: 886-2-2662-5100 FAX: 886-2-2662-3094

VIBRATION TEST LABORATORY
<http://www.kdi.tw>
<http://www.vibration.com.tw>

E-mail:service@kdi.tw

TESTING / INSPECTION REPORT

TESTING EQUIPMENT :

Shock Tester : KING DESIGN DP-1200-60, S/N : R2110086489
 Controller : KING DESIGN KD-1200-03C, S/N : KD674
 Control Accelerometer : B&K 4398, S/N : 2209044

TEST ENVIRONMENT :

Temperature : 24°C (25±10°C)
 Relative Humidity : 66%RH (50±20% RH)

SPECIMEN :

Model : BOXER-6404 (With CFast)
 Quantity : 1 unit

TEST SPECIFICATION :

As per applicant's requirement

Shock test (Operating)
 Wave Form : Half Sine wave
 Acceleration : 50 g
 Duration Time : 11 mS
 No. of Shock : Each axis 3 times
 Shock Direction : ±X, ±Y, ±Z axis


TEST RESULT :

Describe	PASS	FAIL	Non-Judgment
Function judgment ⁽¹⁾	√	---	---
Appearance check ⁽²⁾	√	---	---
(1)—Booting function was normal after the test.			
(2)—No visible damages were found.			


TESTING / INSPECTION REPORT

Testing photos


Tester

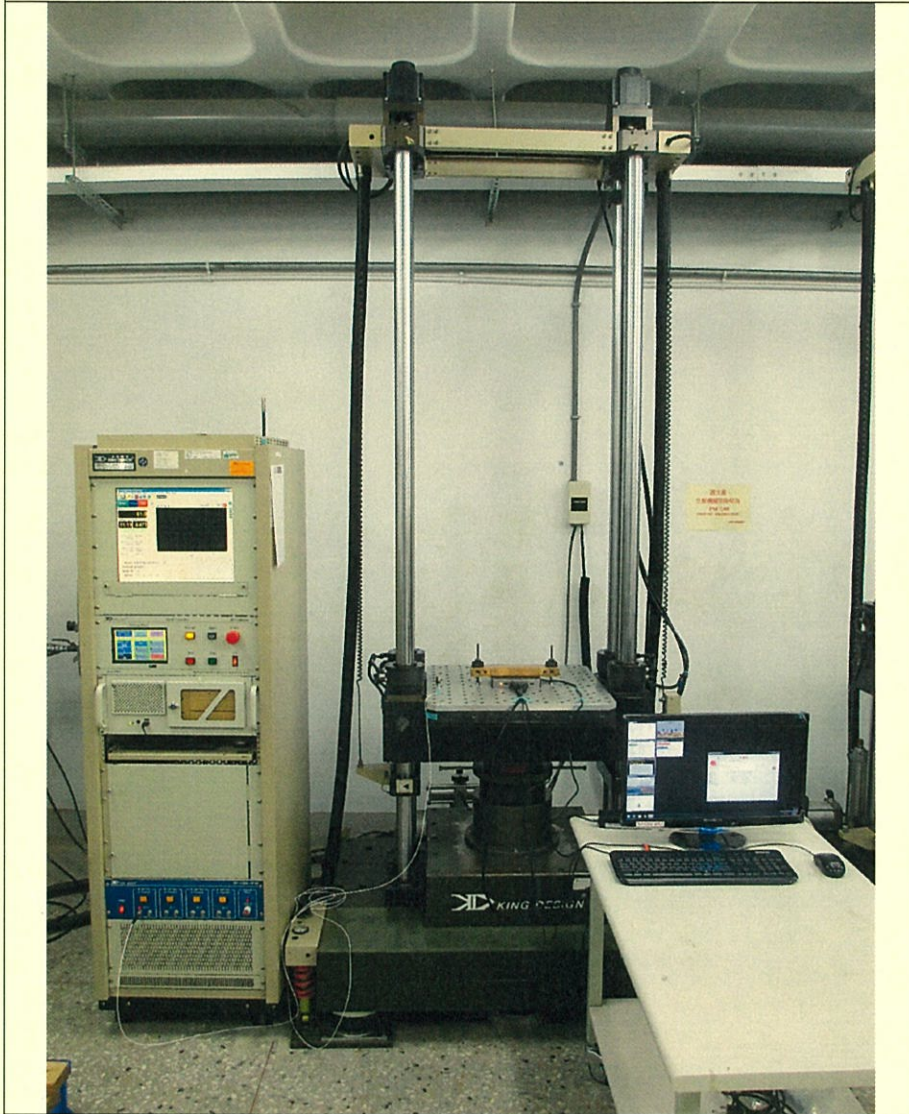

TESTING / INSPECTION REPORT

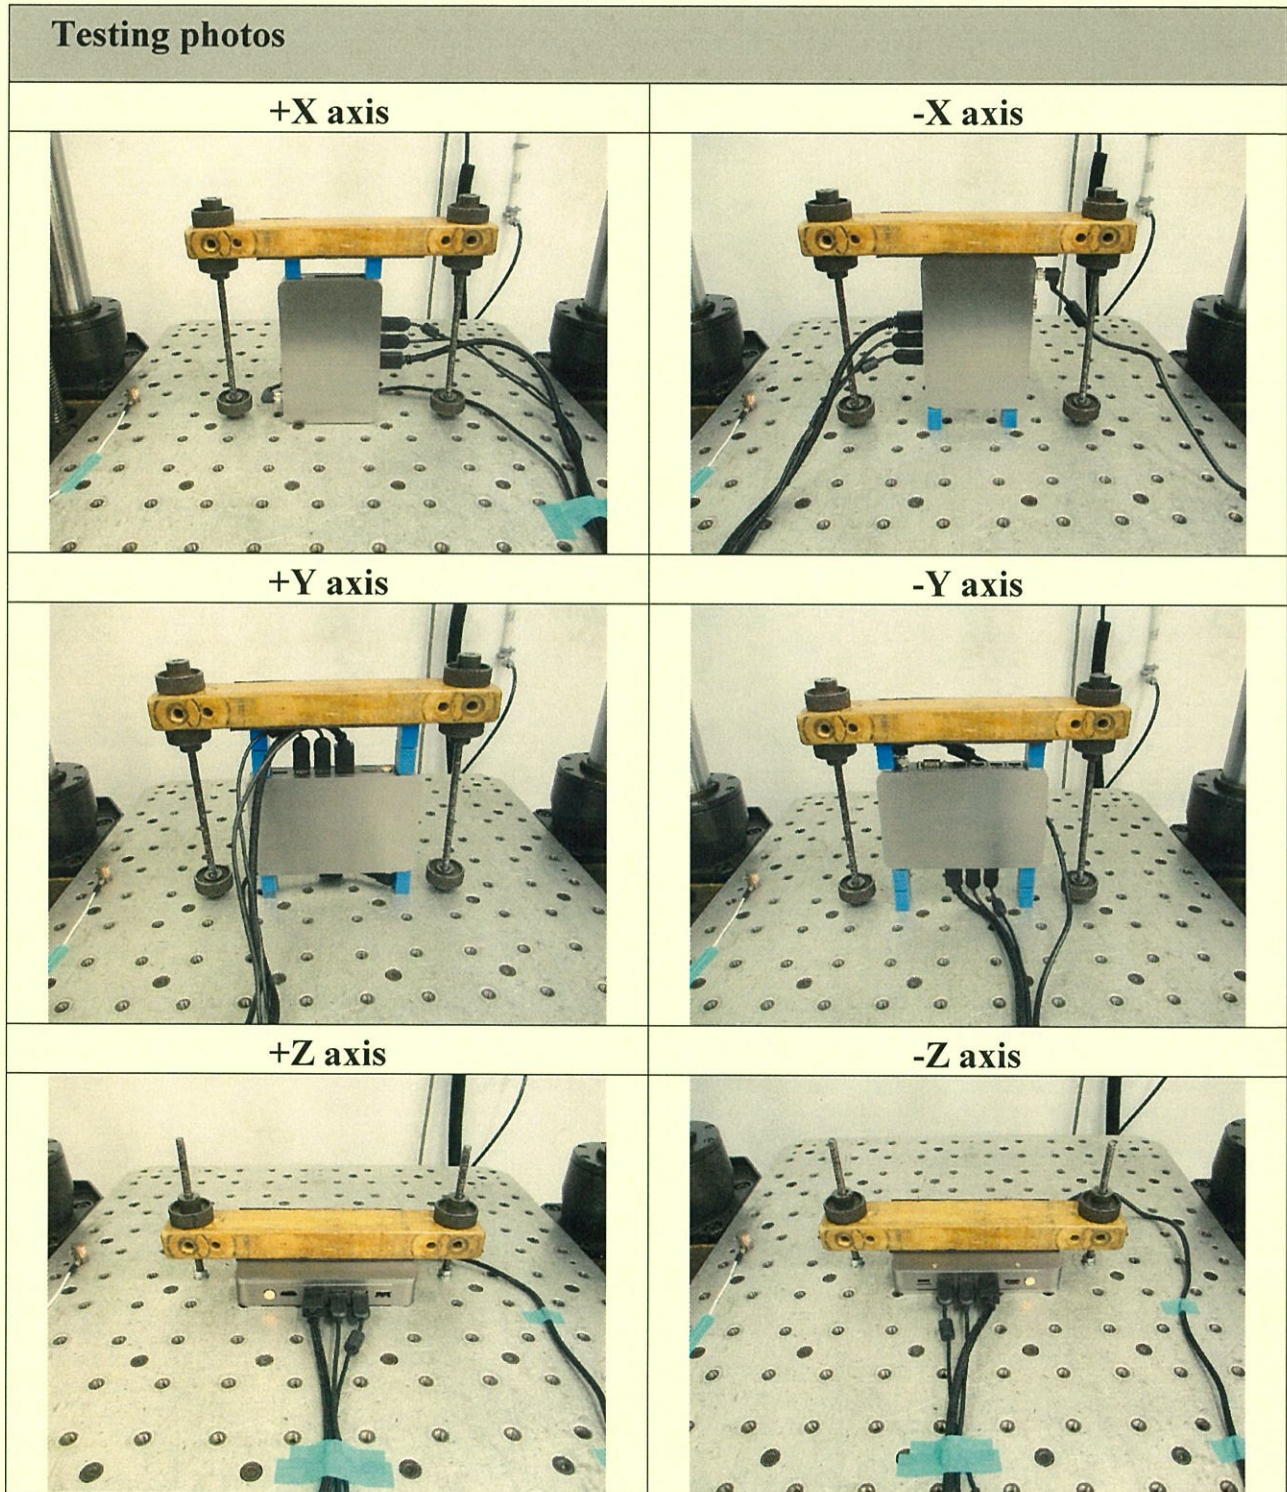


TESTING / INSPECTION REPORT

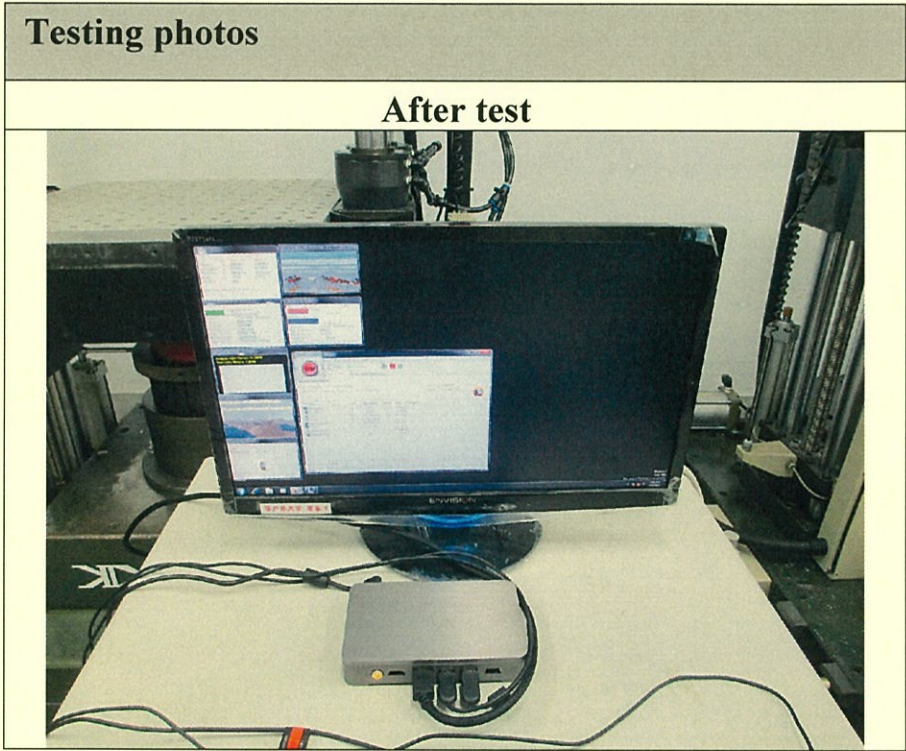



KING DESIGN[®] KING DESIGN INDUSTRIAL CO., LTD. VIBRATION LABORATORY

COMPANY : King Design Industrial Co., Ltd. MODEL : Au-Table S/N : A973L716
SHOCK TEST SPECIFICATION : 50 g 11 ms HEIGHT : 225 mm CYCLE OF TEST : 3/3
Testing at : 2015-6-30 下午 03-36-07 07 Data saved at : 2015-6-30 下午 03-36-07 07

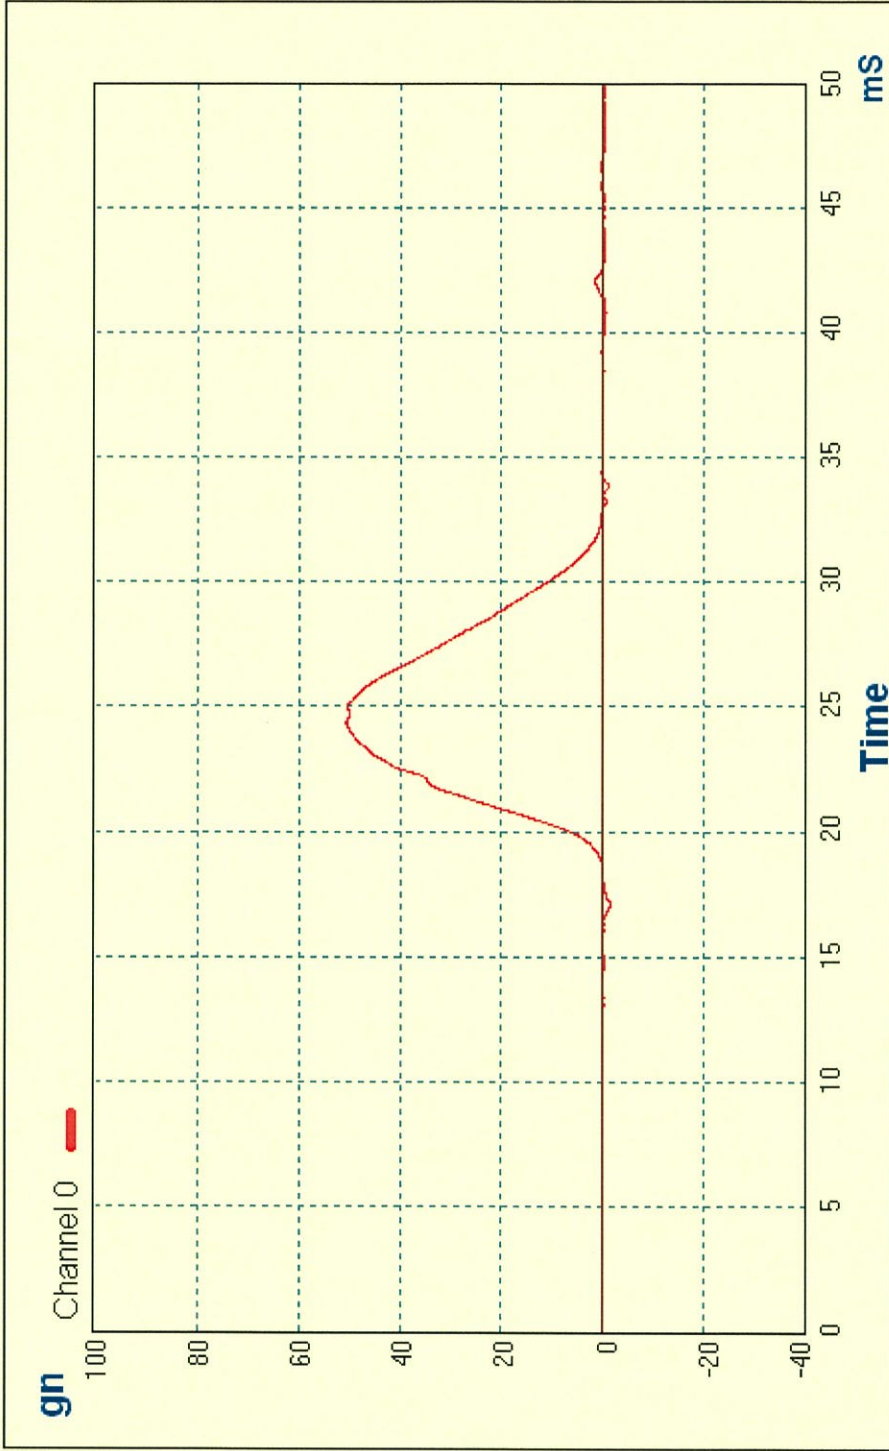


	Acceleration(gn)	Duration time(ms)	Velocity(m/sec)	Filter(Hz)
+X axis (Ch 0)	50.69	11.06	3.441	500



KING DESIGN KING DESIGN INDUSTRIAL CO., LTD. VIBRATION LABORATORY


COMPANY : King Design Industrial Co., Ltd. MODEL : Au-Table S/N : A973L716
SHOCK TEST SPECIFICATION : 50 g 11 ms HEIGHT : 225 mm CYCLE OF TEST : 3/3
Testing at : 2015-6-30 下午 03-41-43 43 Data saved at : 2015-6-30 下午 03-41-43 43

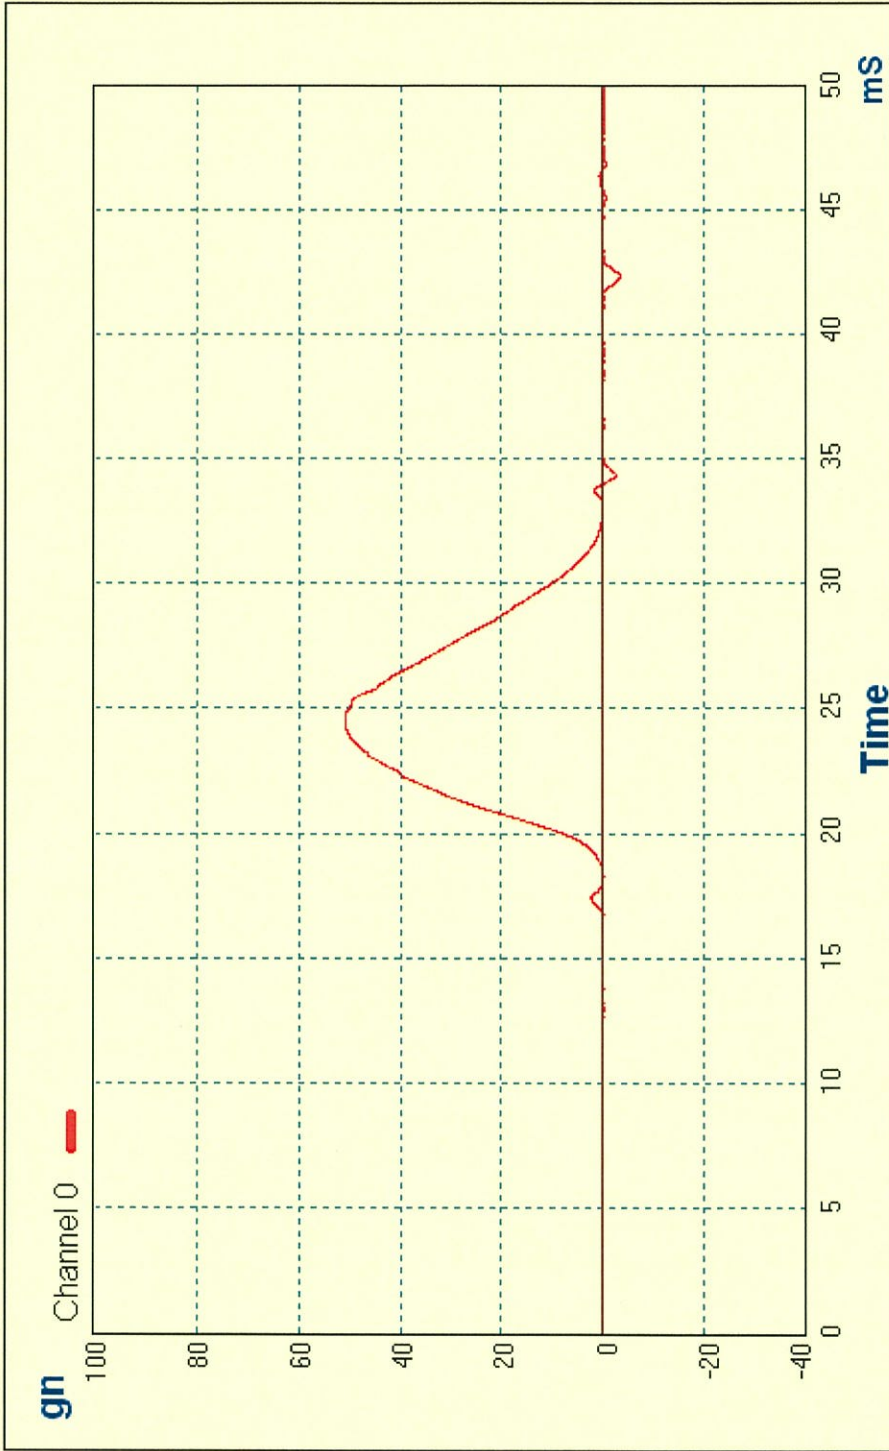

	Acceleration(gn)	Duration time(ms)	Velocity(m/sec)	Filter(Hz)
-X axis (Ch 0)	50.97	11.09	3.447	500



COMPANY : King Design Industrial Co., Ltd. MODEL : Au-Table S/N : A973L716
SHOCK TEST SPECIFICATION : 50 g 11 mS HEIGHT : 225 mm CYCLE OF TEST : 3/3
Testing at : 2015-6-30 下午 03-51-23 23 Data saved at : 2015-6-30 下午 03-51-24 24

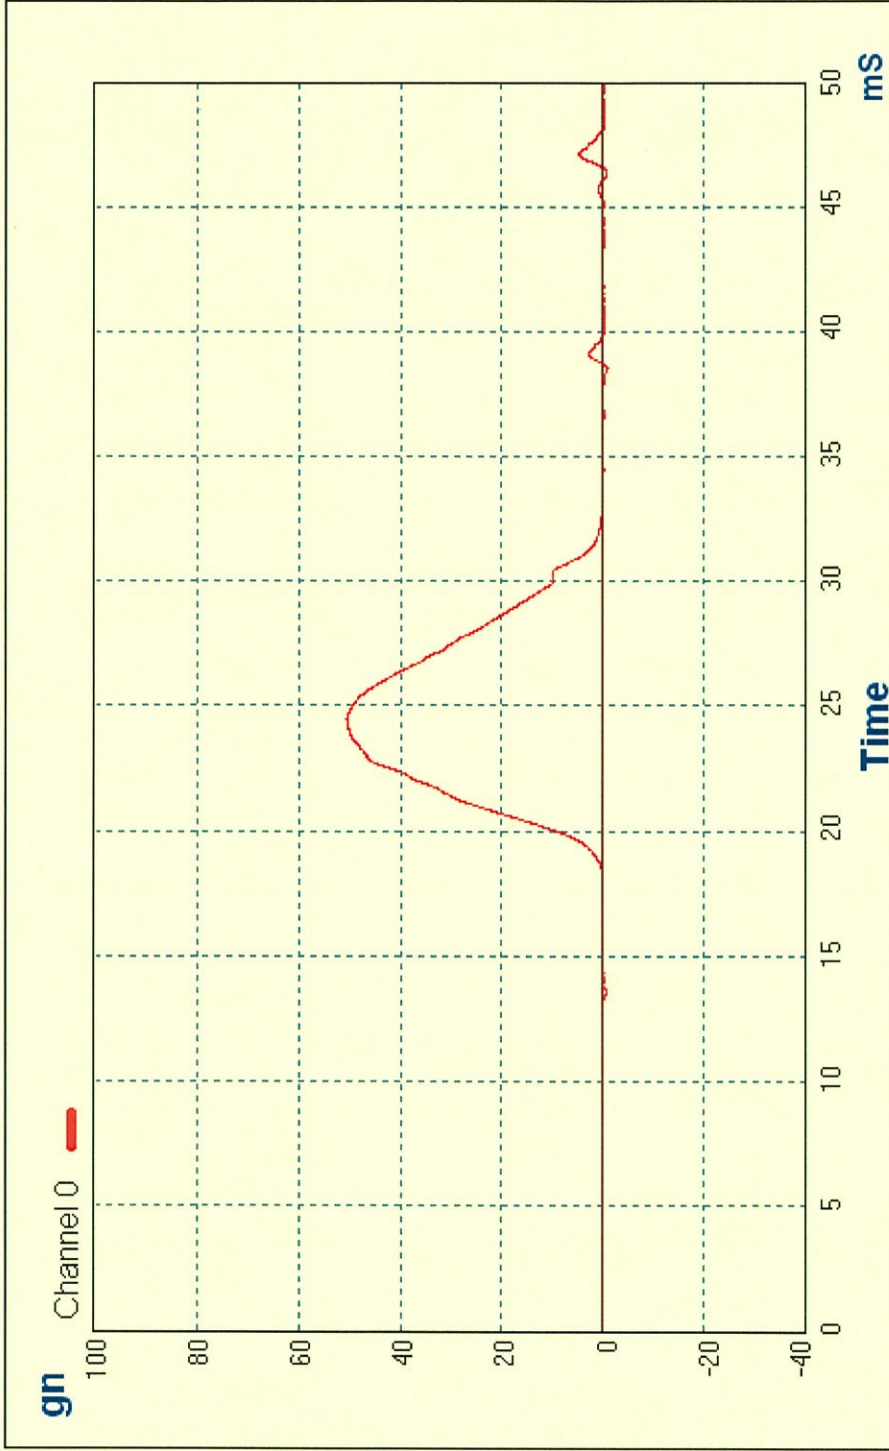


	Acceleration(gn)	Duration time(ms)	Velocity(m/sec)	Filter(Hz)
+Y axis (Ch 0)	50.65	11.09	3.434	500



KING DESIGN KING DESIGN INDUSTRIAL CO., LTD. VIBRATION LABORATORY

COMPANY : King Design Industrial Co., Ltd. MODEL : Au-Table S/N : A973L716
SHOCK TEST SPECIFICATION : 50 g 11 ms HEIGHT : 225 mm CYCLE OF TEST : 3/3
Testing at : 2015-6-30 下午 03-56-02 02 Data saved at : 2015-6-30 下午 03-56-03 03

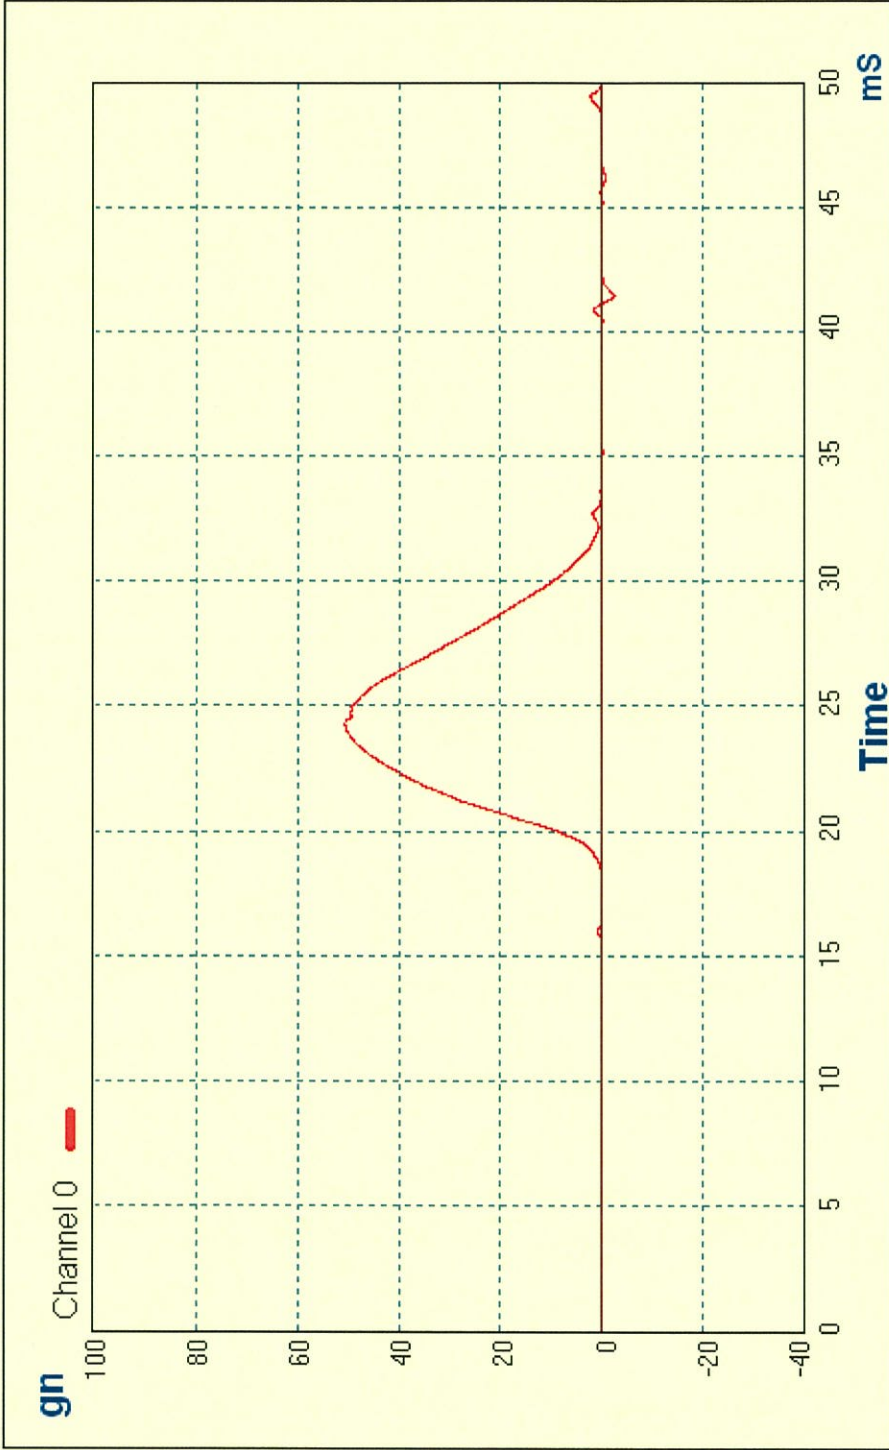


	Acceleration(gn)	Duration time(ms)	Velocity(m/sec)	Filter(Hz)
-Y axis (Ch 0)	50.69	11.17	3.437	500



KING DESIGN® KING DESIGN INDUSTRIAL CO., LTD. VIBRATION LABORATORY

COMPANY : King Design Industrial Co., Ltd. MODEL : Au-Table S/N : A973L716
SHOCK TEST SPECIFICATION : 50 g 11 ms HEIGHT : 225 mm CYCLE OF TEST : 3/3
Testing at : 2015-6-30 下午 03-59-00 00 Data saved at : 2015-6-30 下午 03-59-01 01

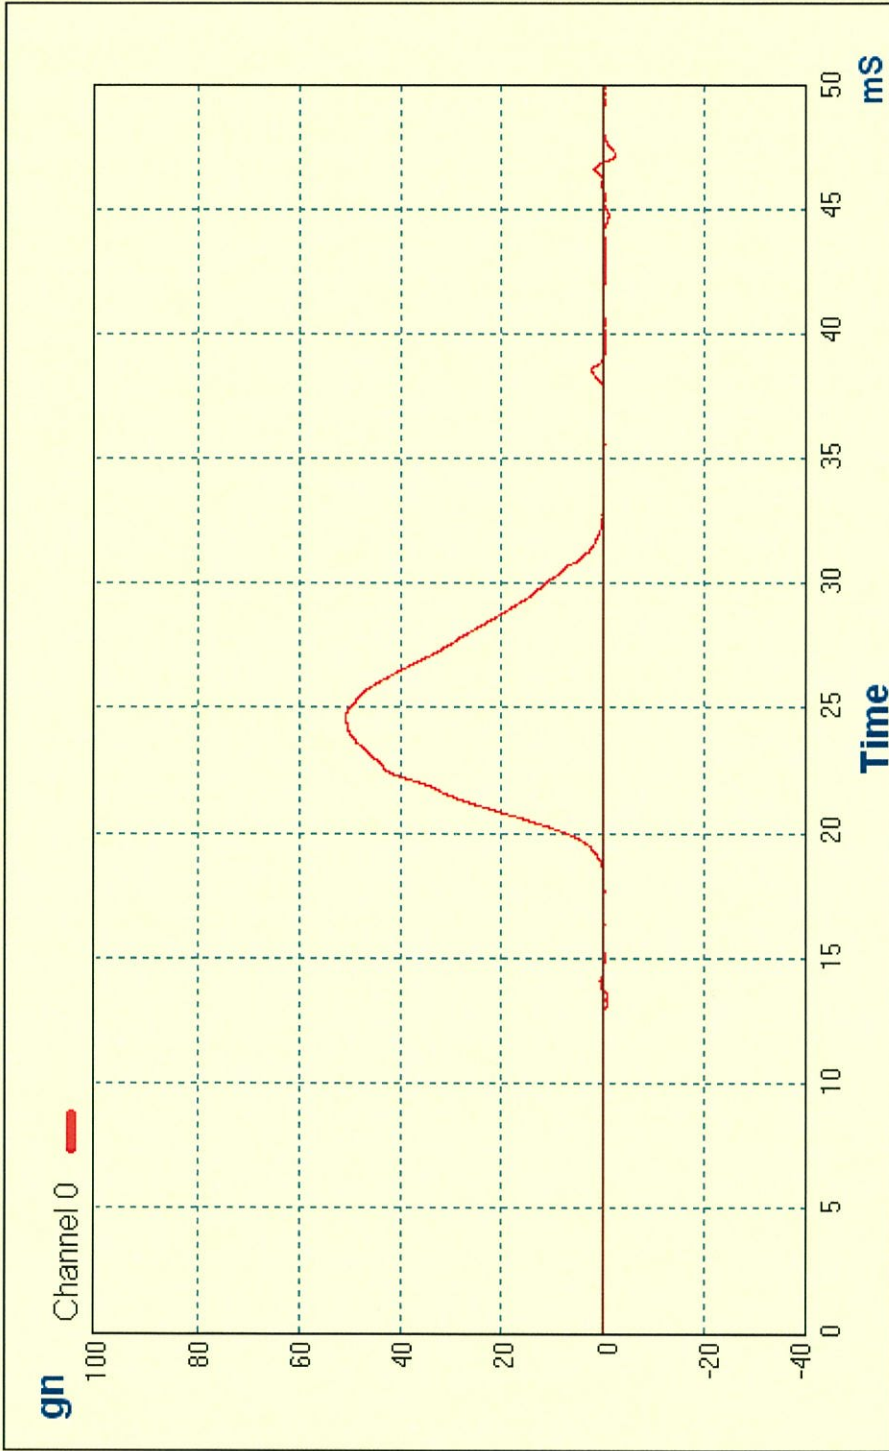


	Acceleration(gn)	Duration time(ms)	Velocity(m/sec)	Filter(Hz)
+Z axis (Ch 0)	50.80	11.15	3.463	500



KING DESIGN[®] KING DESIGN INDUSTRIAL CO., LTD. VIBRATION LABORATORY

COMPANY : King Design Industrial Co., Ltd. MODEL : Au-Table S/N : A973L716
SHOCK TEST SPECIFICATION : 50 g 11 ms HEIGHT : 225 mm CYCLE OF TEST : 3/3
Testing at : 2015-6-30 下午 04-06-06 06 Data saved at : 2015-6-30 下午 04-06-06 06

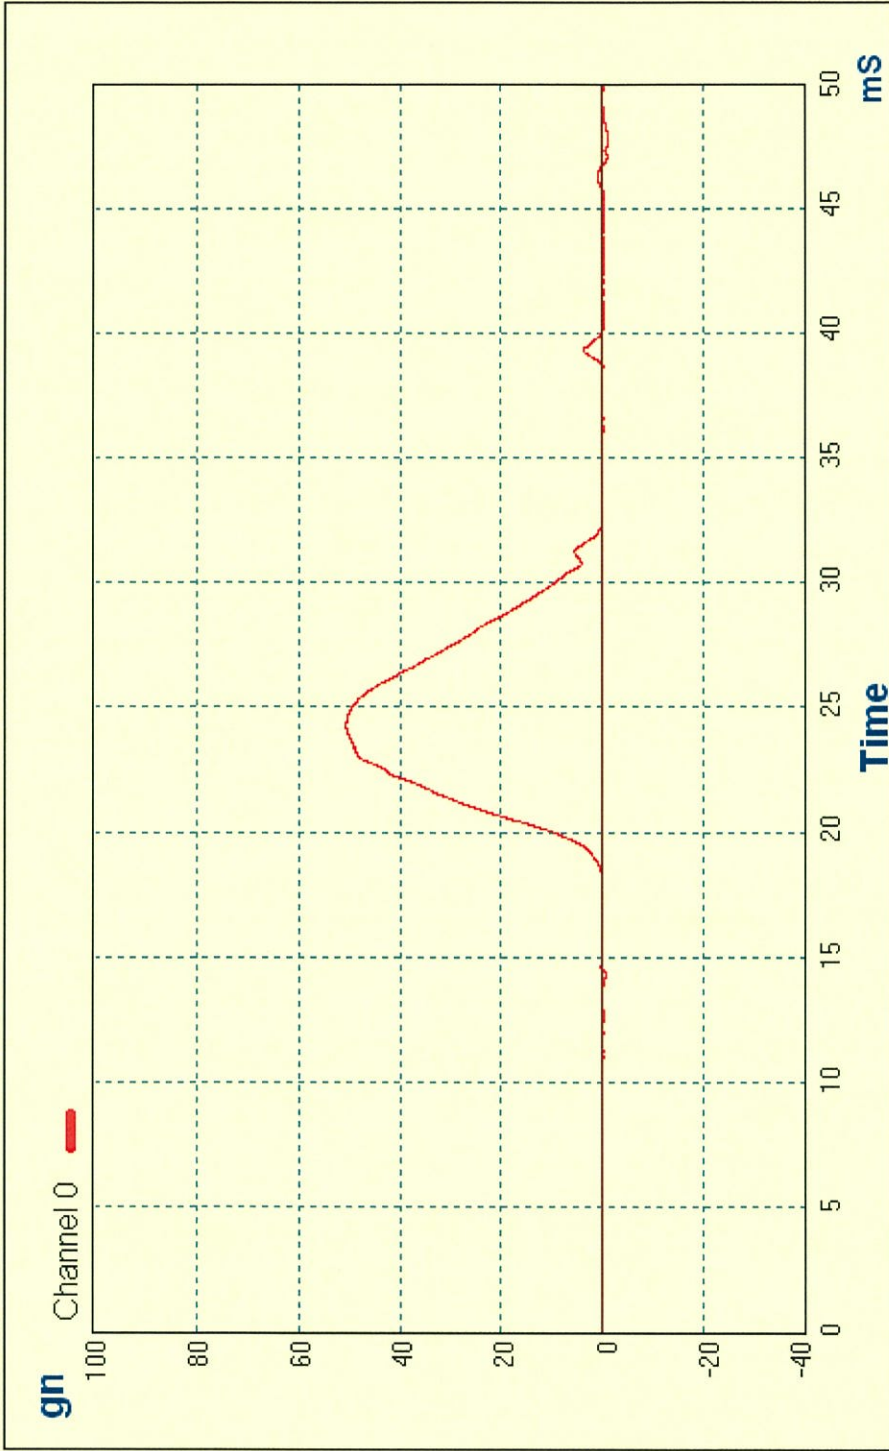

	Acceleration(gn)	Duration time(ms)	Velocity(m/sec)	Filter(Hz)
-Z axis (Ch 0)	50.89	11.02	3.505	500

-END-