

KING DESIGN INDUSTRIAL CO., LTD.4F, NO. 3, Lane 270, Pei Shen Road Sec. 3,
Shen Keng Dist., New Taipei City, 222, Taiwan, R.O.C
TEL: 886-2-2662-5100 FAX: 886-2-2662-3094**VIBRATION TEST LABORATORY**<http://www.kdi.tw>
<http://www.vibration.com.tw>
E-mail:service@kdi.tw**TESTING / INSPECTION REPORT**




REPORT NO : VT-160108-2

COMPANY : AAEON Technology Inc.
ADDRESS : 5F, No.135, Lane 235, Pao Chiao Rd.
Hsin-Tien City, Taipei, Taiwan, R. O. C.
TEL : 886-2-8919-1234
FAX : 886-2-8919-1049
SPECIMEN : VPC-5500S (With SSD)
DATE OF RECEIVED : 2016/01/07
DATE OF TESTED : 2016/01/08

TEST / INSPECTION ITEMS : Vibration Test

REMARKS :

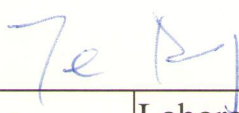- The laboratory is accredited by ISO/IEC 17025 General Requirements for the Competence of Calibration and Testing Laboratory.
- The results only apply to the device under test.
- This report is 13 pages, and no part of it may be abstracted or reproduced.

Test Engineer : 	
Approval Signatory: 2016.1.15 	Laboratory Head : 

金頓科技

KING DESIGN INDUSTRIAL CO., LTD.

4F, NO. 3, Lane 270, Pei Shen Road Sec. 3,

Shen Keng Dist., New Taipei City, 222, Taiwan, R.O.C

TEL: 886-2-2662-5100 FAX: 886-2-2662-3094

VIBRATION TEST LABORATORY<http://www.kdi.tw><http://www.vibration.com.tw>

E-mail:service@kdi.tw

TESTING / INSPECTION REPORT

TESTING EQUIPMENT :

Vibration Tester : KING DESIGN KD-9363EM-600F2K-50N120,
S/N : KDS11054986

Controller : VCS-913+, S/N : 1312384

Control Accelerometer : Wilcoxon Research WR-777, S/N : 4207

Calibration Date : 2015/11/25

TEST ENVIRONMENT :

Temperature : 25°C (25±10°C)

Relative Humidity : 65% RH (50±25% RH)

SPECIMEN :

Model : VPC-5500S (With SSD)

Quantity : 1 unit

KING DESIGN INDUSTRIAL CO., LTD.

4F, NO. 3, Lane 270, Pei Shen Road Sec. 3,

Shen Keng Dist., New Taipei City, 222, Taiwan, R.O.C

TEL: 886-2-2662-5100 FAX: 886-2-2662-3094

VIBRATION TEST LABORATORY
<http://www.kdi.tw>
<http://www.vibration.com.tw>

E-mail:service@kdi.tw

TESTING / INSPECTION REPORT

TEST SPECIFICATION (1) :

Reference to MIL-STD 810G 514.6 Figure 514.6C-1

Random vibration test (Operating)

Frequency : 10 Hz to 500 Hz

P.S.D. :

Vertical		Transverse		Longitudinal	
Frequency Hz	P.S.D. g ² /Hz	Frequency Hz	P.S.D. g ² /Hz	Frequency Hz	P.S.D. g ² /Hz
10	0.01500	10	0.00013	10	0.00650
40	0.01500	20	0.00065	20	0.00650
500	0.00015	30	0.00065	120	0.00020
rms = 1.04 g		78	0.00002	121	0.00300
		79	0.00019	200	0.00300
		120	0.00019	240	0.00150
		500	0.00001	340	0.00003
		rms = 0.20 g		rms = 0.74 g	

Test Direction : Vertical, Transverse, Longitudinal axis

Test Times : 1 hr (each axis)

Total Test Time : 3 hrs

KING DESIGN INDUSTRIAL CO., LTD.
4F, NO. 3, Lane 270, Pei Shen Road Sec. 3,
Shen Keng Dist., New Taipei City, 222, Taiwan, R.O.C
TEL: 886-2-2662-5100 FAX: 886-2-2662-3094
VIBRATION TEST LABORATORY
<http://www.kdi.tw>
<http://www.vibration.com.tw>
E-mail:service@kdi.tw

TESTING / INSPECTION REPORT

TEST SPECIFICATION (2) :

Reference to MIL-STD 810G 514.6 Figure 514.6E-1

Random vibration test (Non-Operating)

Frequency : 20 Hz to 2,000 Hz

Acceleration : 7.7 g rms

P.S.D. : 0.04 g²/Hz (20 Hz)

: 0.04 g²/Hz (1,000 Hz)

: -6 dB/Oct (2,000 Hz)

Test Axis : X, Y, Z axis

Test Time : 1 hr (Each axis)

Total Test Time : 3 hrs

TEST RESULT :

Describe	PASS	FAIL	Non-Judgment
Function judgment ⁽¹⁾	√	---	---
Appearance check ⁽²⁾	√	---	---
(1)—Booting function was normal after the test.			
(2)—No visible damages were found.			

KING DESIGN INDUSTRIAL CO., LTD.

4F, NO. 3, Lane 270, Pei Shen Road Sec. 3,

Shen Keng Dist., New Taipei City, 222, Taiwan, R.O.C

TEL: 886-2-2662-5100 FAX: 886-2-2662-3094




VIBRATION TEST LABORATORY
<http://www.kdi.tw>
<http://www.vibration.com.tw>

E-mail:service@kdi.tw

TESTING / INSPECTION REPORT


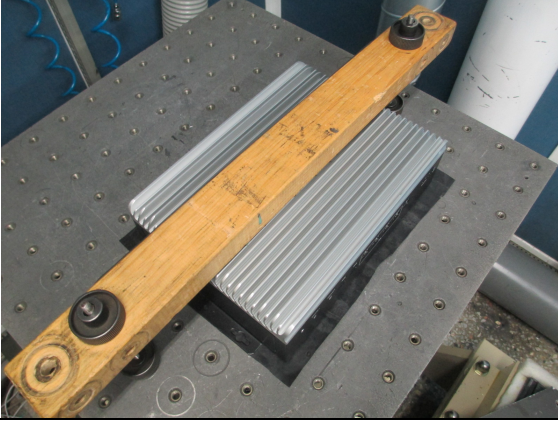
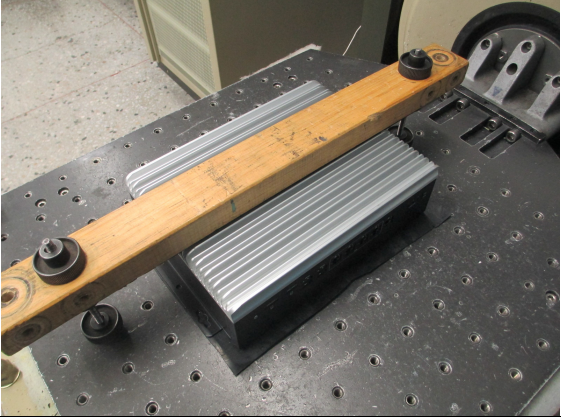
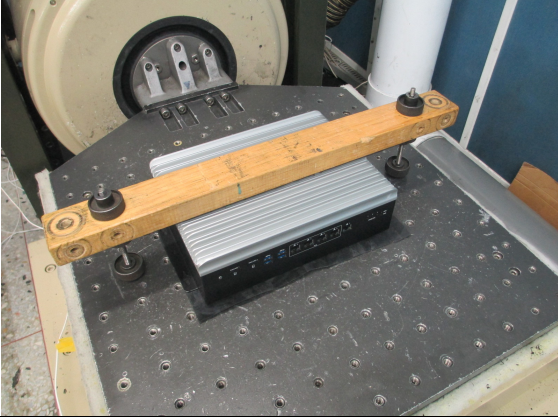
Testing photos (Operating)

Tester

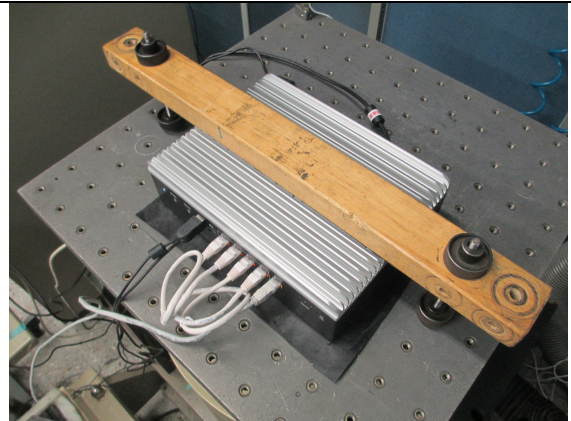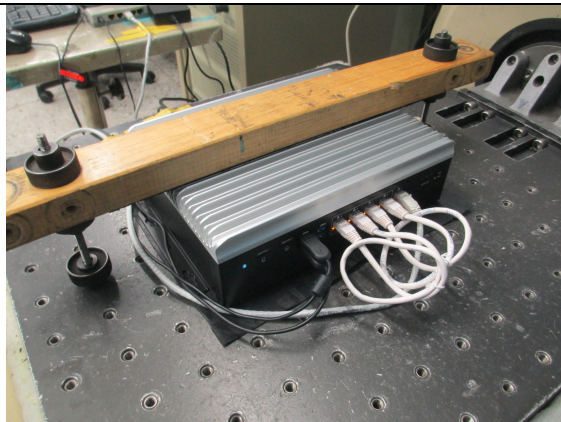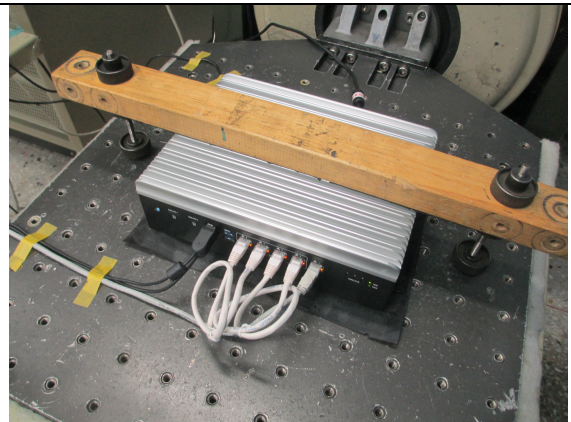Z

X

Y


TESTING / INSPECTION REPORT

Testing photos (Non-Operating)

Tester	Z
	
X	Y
	

KING DESIGN INDUSTRIAL CO., LTD.

4F, NO. 3, Lane 270, Pei Shen Road Sec. 3,

Shen Keng Dist., New Taipei City, 222, Taiwan, R.O.C

TEL: 886-2-2662-5100 FAX: 886-2-2662-3094

VIBRATION TEST LABORATORY

<http://www.kdi.tw>

<http://www.vibration.com.tw>

E-mail:service@kdi.tw


TESTING / INSPECTION REPORT

Testing photos

After test



Vertical

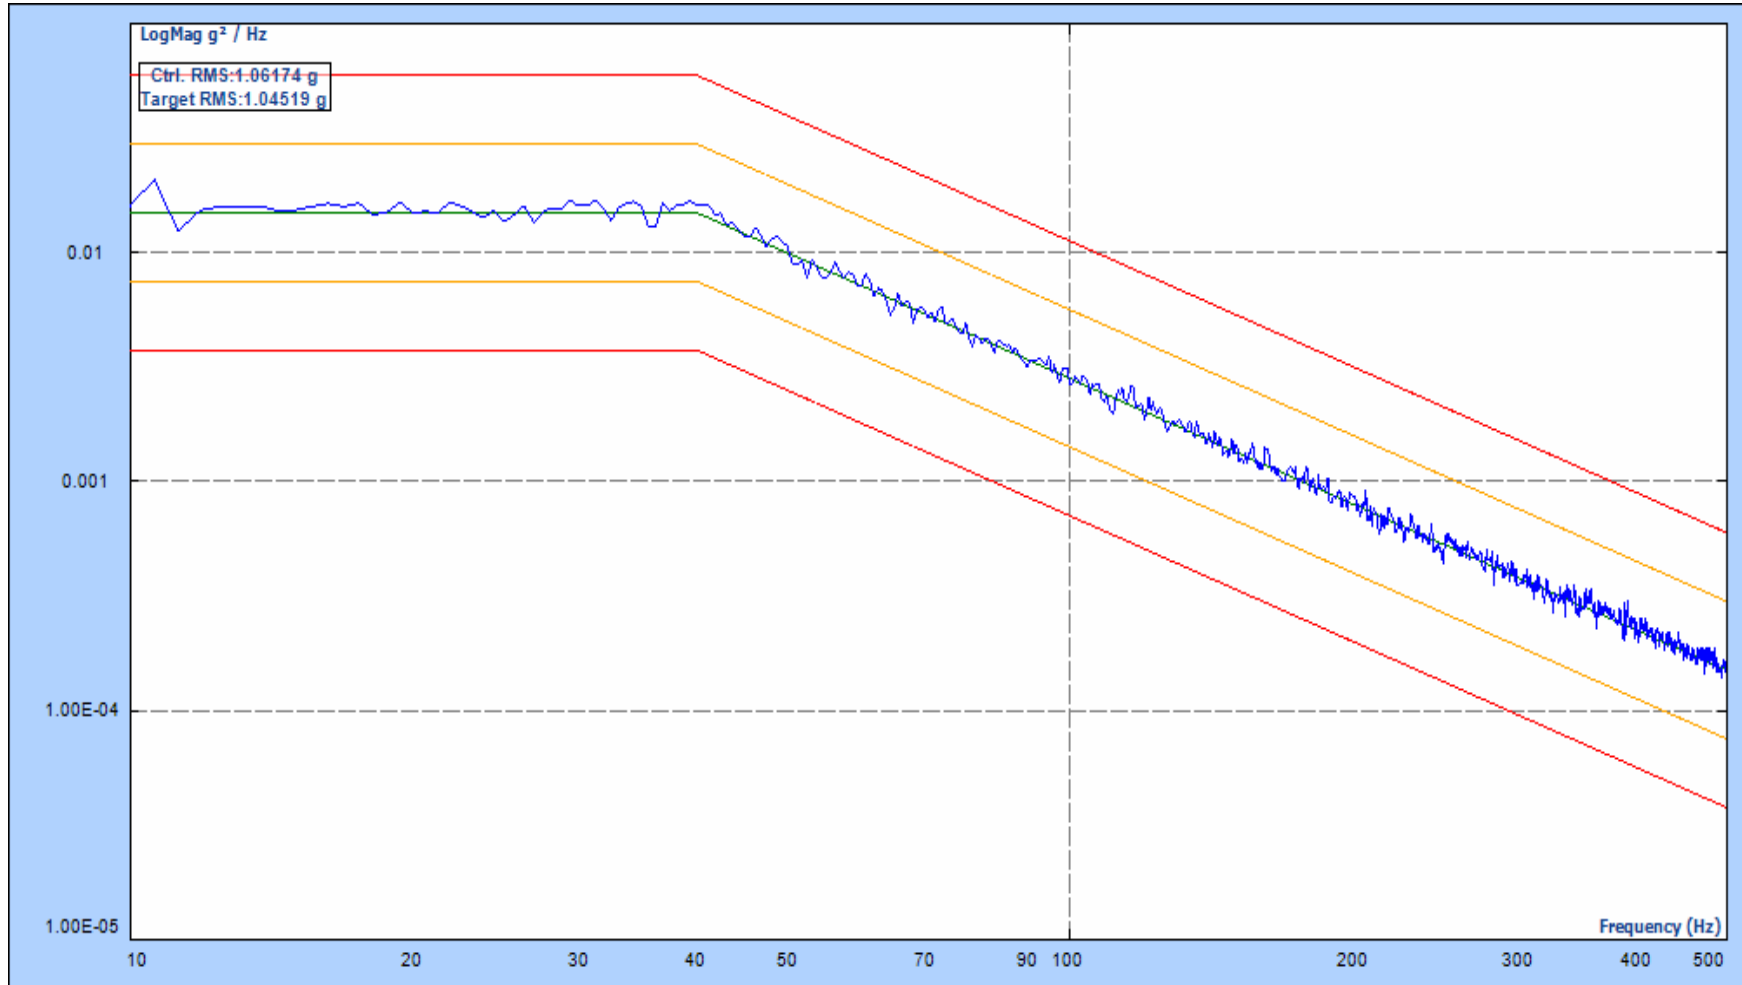

Level: 100.00 %

Velocity Pk: 173.7 mm/s

Remaining: 00:00:00

Drive Pk: 0.326V

Control RMS: 1.062 g


Total Elapsed: 01:01:55

Est. Disp. : 3.612 mm Pk-Pk

Target RMS: 1.045 g

Full Level Elapsed: 01:00:00

Transverse

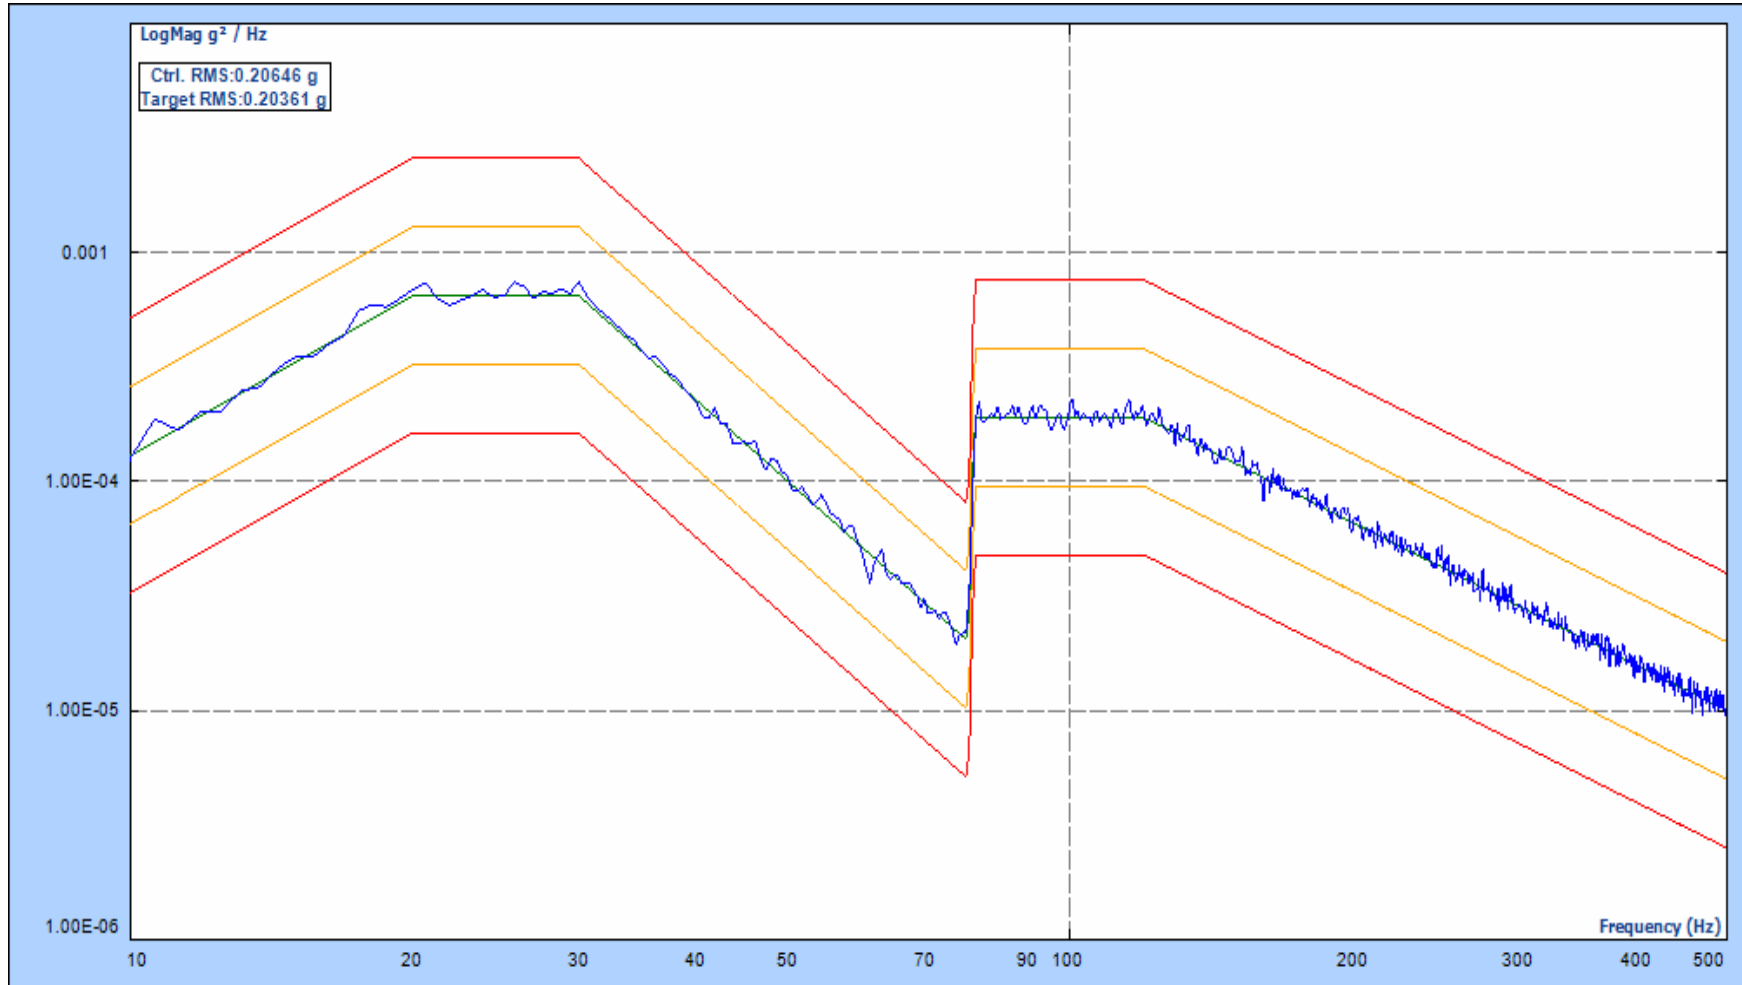

Level: 100.00 %

Velocity Pk: 26.93 mm/s

Remaining: 00:00:00

Drive Pk: 0.068V

Control RMS: 0.206 g


Total Elapsed: 01:01:50

Est. Disp. : 0.477 mm Pk-Pk

Target RMS: 0.203 g

Full Level Elapsed: 01:00:00

Longitudinal

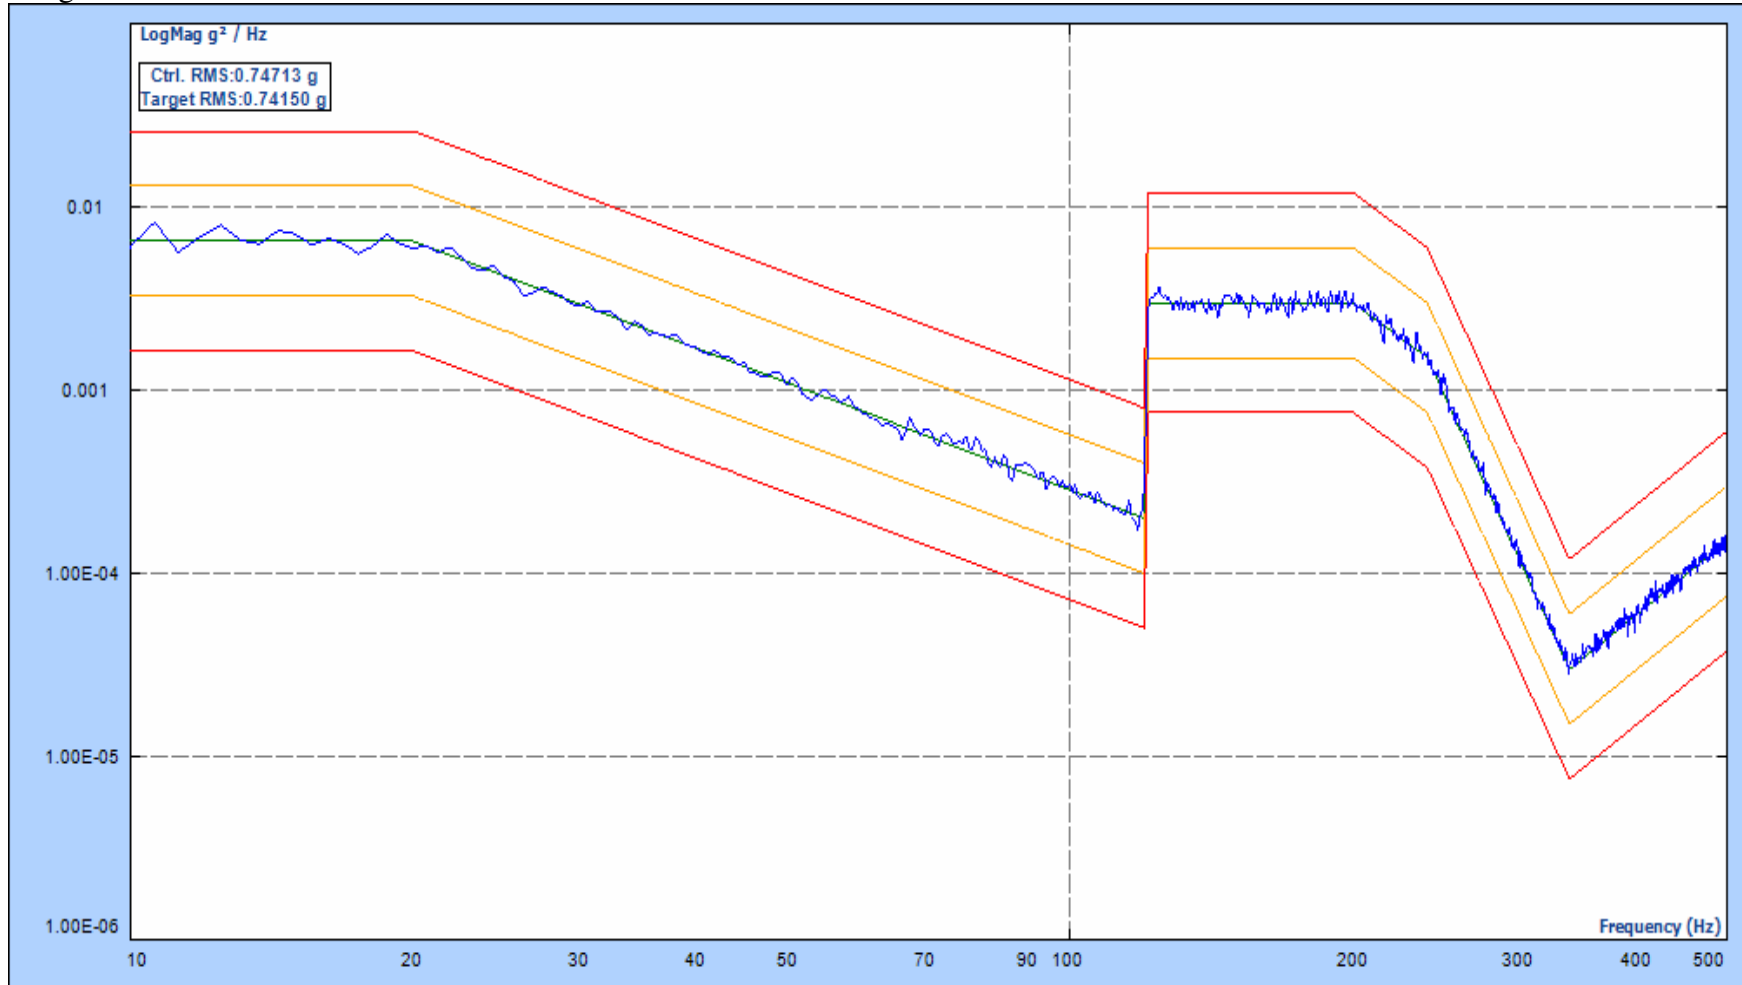

Level: 100.00 %

Velocity Pk: 102.7 mm/s

Remaining: 00:00:00

Drive Pk: 0.210V

Control RMS: 0.747 g


Total Elapsed: 01:01:55

Est. Disp. : 2.291 mm Pk-Pk

Target RMS: 0.741 g

Full Level Elapsed: 01:00:00

X axis

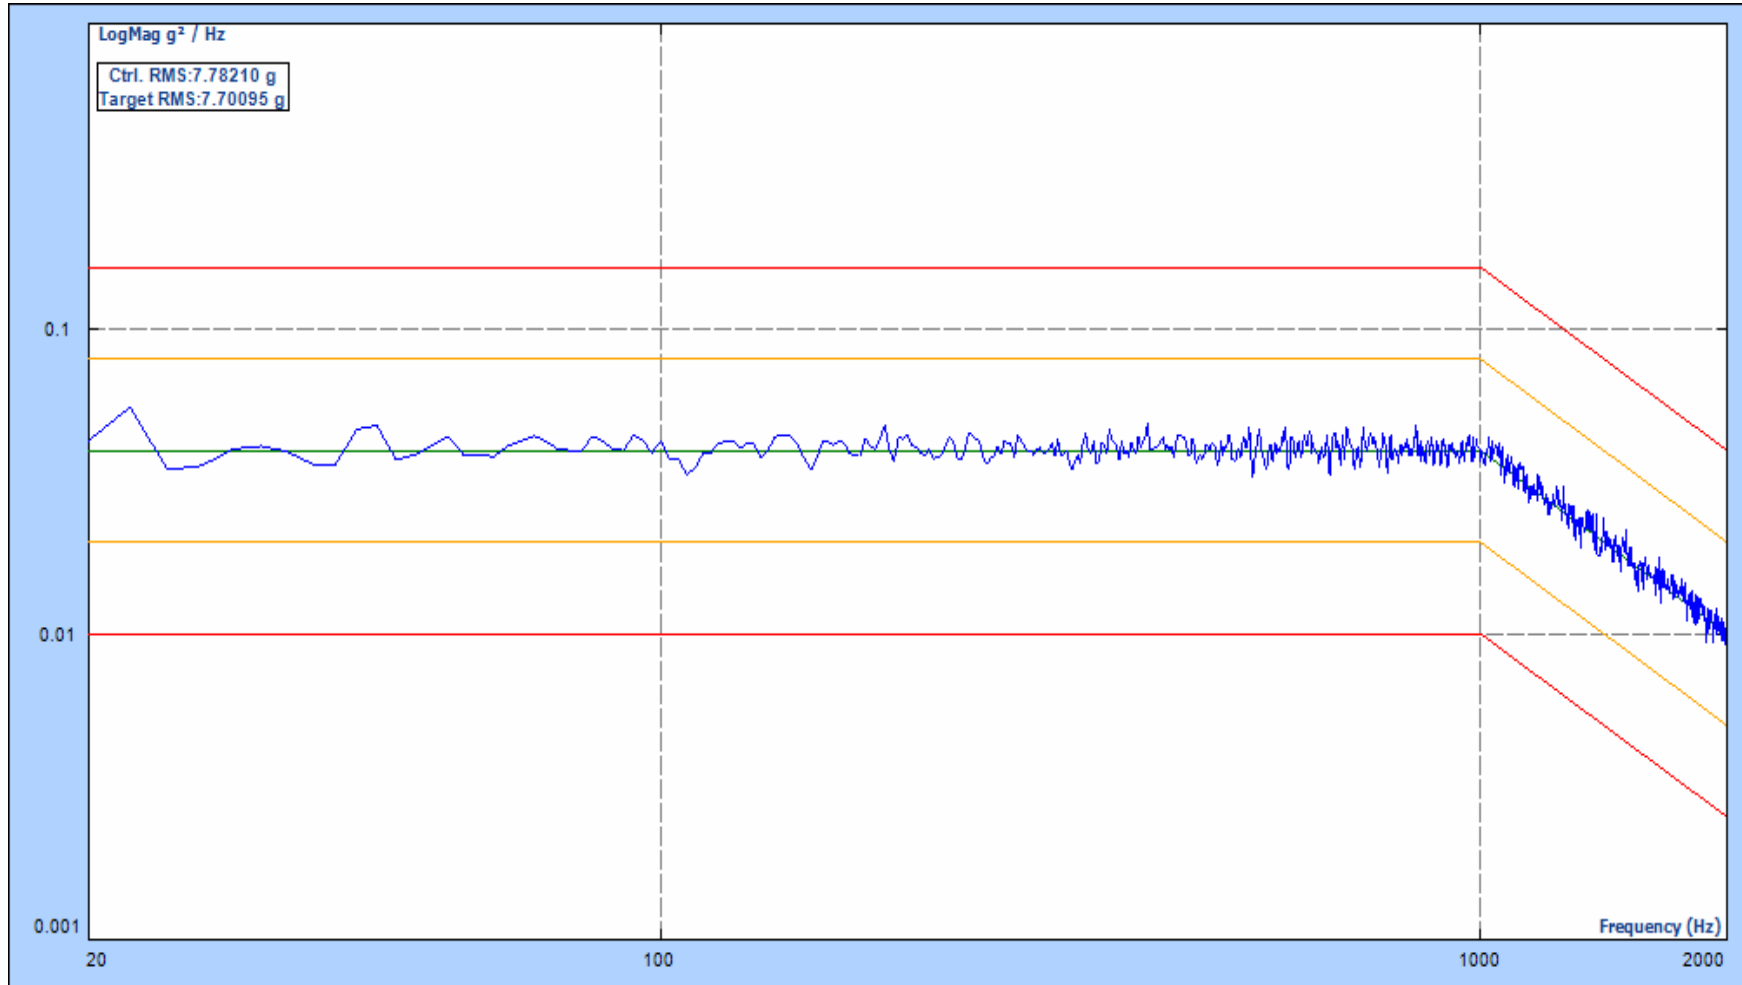

Level: 100.00 %

Velocity Pk: 219.5 mm/s

Remaining: 00:00:00

Drive Pk: 1.543V

Control RMS: 7.782 g


Total Elapsed: 01:01:08

Est. Disp. : 2.195 mm Pk-Pk

Target RMS: 7.699 g

Full Level Elapsed: 01:00:00

Y axis

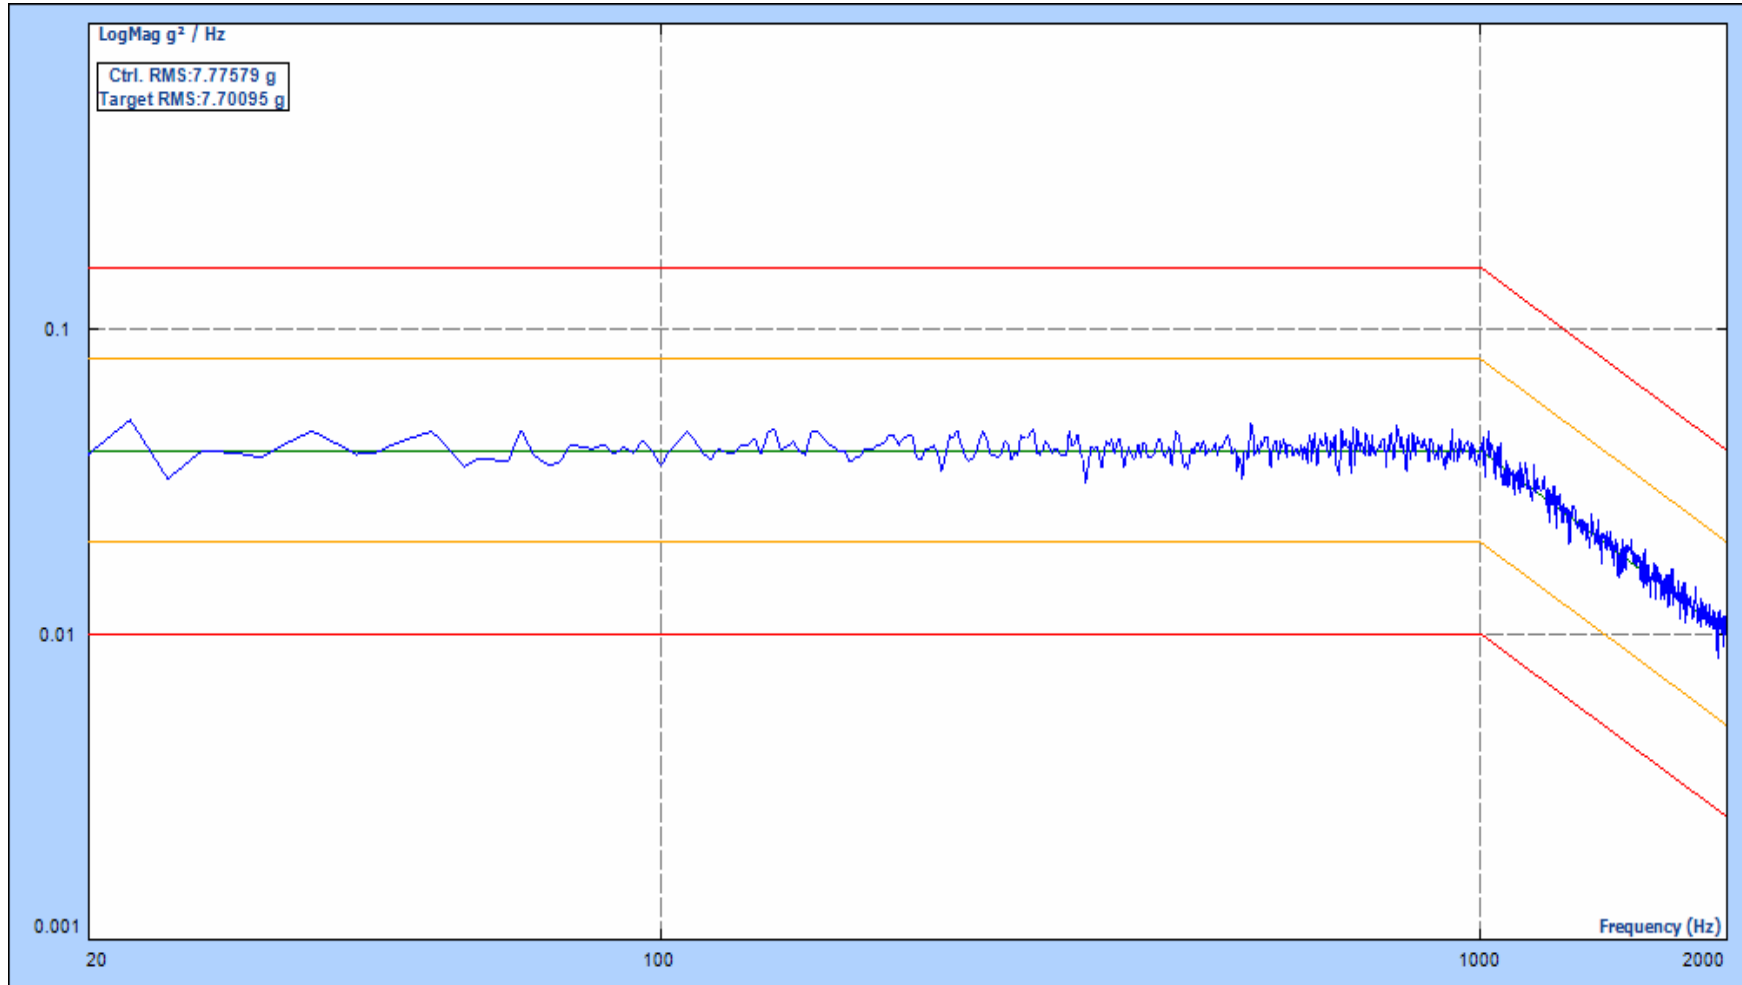

Level: 100.00 %

Velocity Pk: 217.3 mm/s

Remaining: 00:00:00

Drive Pk: 1.657V

Control RMS: 7.776 g


Total Elapsed: 01:01:08

Est. Disp. : 2.141 mm Pk-Pk

Target RMS: 7.699 g

Full Level Elapsed: 01:00:00

Z axis

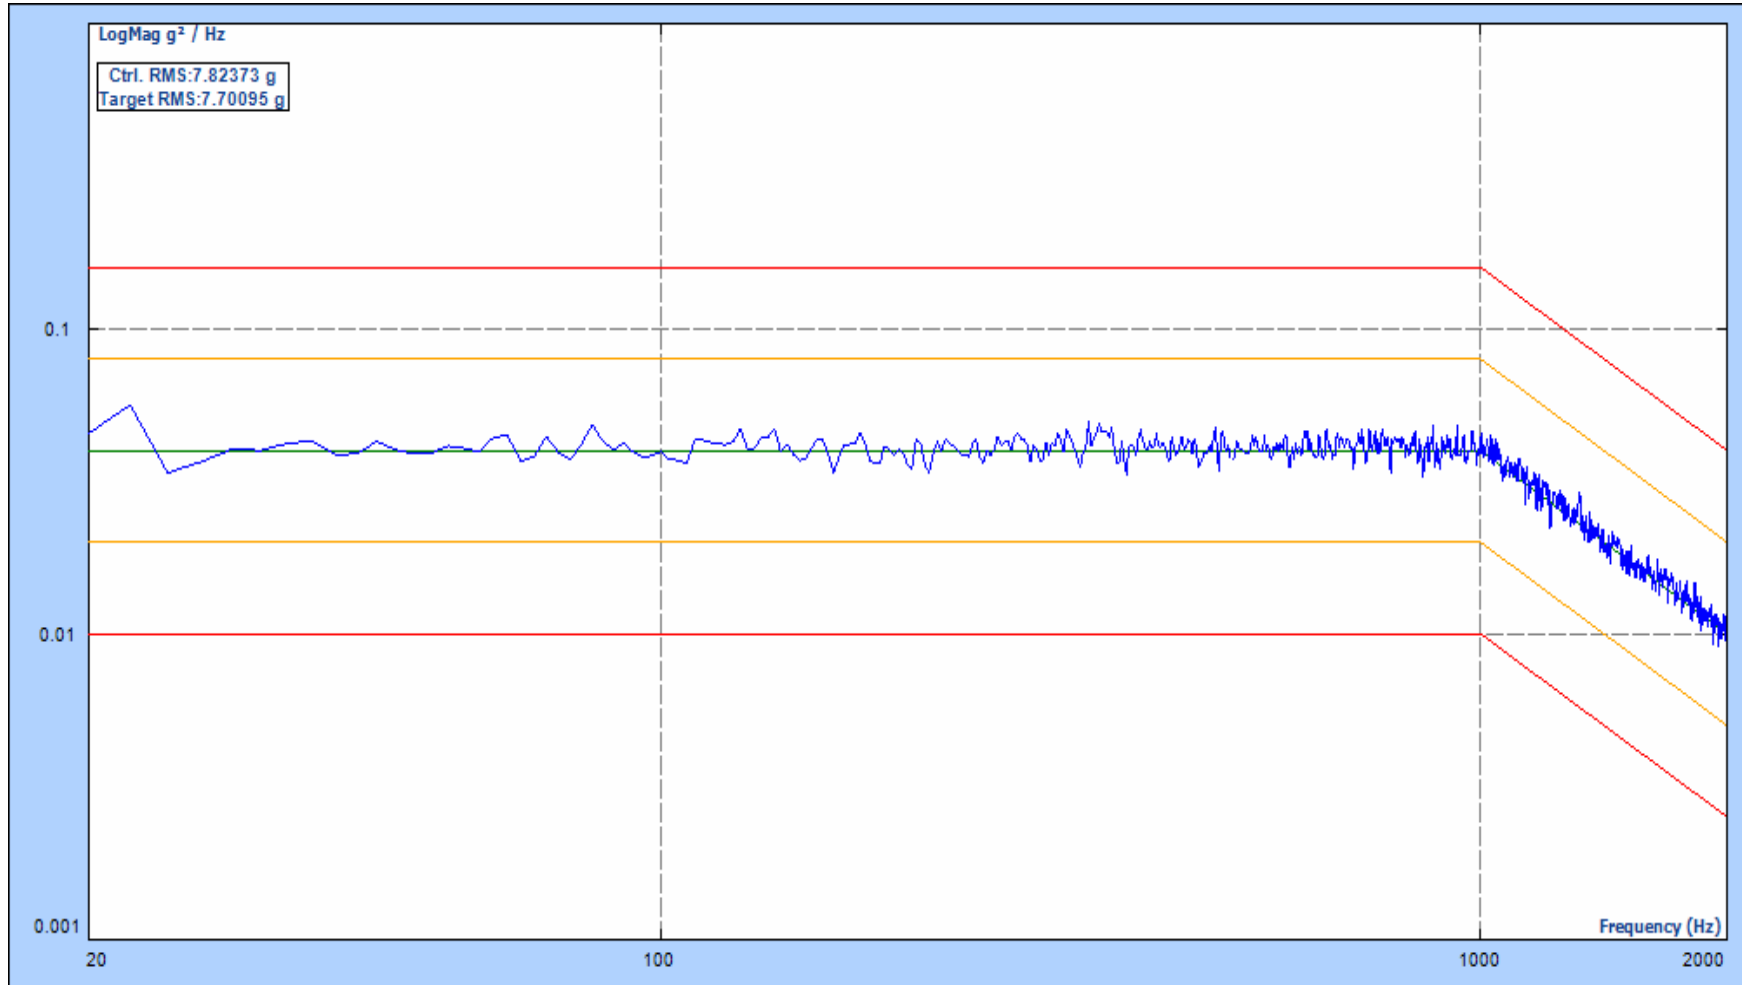

Level: 100.00 %

Velocity Pk: 220.8 mm/s

Remaining: 00:00:00

-END-

Drive Pk: 1.483V

Control RMS: 7.824 g

Total Elapsed: 01:01:07

Est. Disp. : 2.221 mm Pk-Pk

Target RMS: 7.699 g

Full Level Elapsed: 01:00:00